

# User Manual

## CP030/CP030A

## CP031/CP031A

## Current Probes



CP030/CP030A and CP031/CP031A  
Current Probes  
**User Manual**

May, 2021





## CP030/CP030A and CP031/CP031A Current Probes User Manual

© 2021 Teledyne LeCroy, Inc. All rights reserved.

Users are permitted to duplicate and distribute Teledyne LeCroy documentation for internal training purposes only. Resale or unauthorized duplication of Teledyne LeCroy documentation materials is strictly prohibited.

Teledyne LeCroy is a registered trademark of Teledyne LeCroy, Inc. Other product or brand names are trademarks or requested trademarks of their respective holders. Information in this publication supersedes all earlier versions. Specifications are subject to change without notice.

933272-00 Rev A

cp03x-cp03xa-user-manual\_05may21.pdf

May, 2021

# Contents

Safety Instructions ..... 1

    Symbols ..... 1

    Precautions ..... 1

Introduction ..... 3

Specifications..... 4

    Warranted Characteristics ..... 4

    Nominal Characteristics..... 4

    Typical Characteristics ..... 5

    Environmental Characteristics..... 5

    Physical Characteristics..... 5

    Safety Ratings ..... 6

    CP030/CP030A Derating Curve - Maximum Input Current vs. Frequency\*..... 7

    CP030/CP030A Insertion Impedance vs. Frequency\*..... 7

    CP031/CP031A Derating Curve - Maximum Input Current vs. Frequency..... 8

    CP031/CP031A Insertion Impedance vs. Frequency ..... 8

Operation ..... 9

    Precautions..... 9

    Connecting to the Test Instrument..... 10

    Connecting to the Test Circuit ..... 10

    Operating with an Oscilloscope ..... 11

Performance Verification..... 13

    Test Equipment Required..... 13

    Preliminary Procedure ..... 14

    Functional Check ..... 14

    Check LF Accuracy..... 15

    CP03x Test Record..... 17

Care and Maintenance ..... 18

    Cleaning ..... 18

    Calibration Interval..... 18

    Service Strategy ..... 18

    Troubleshooting ..... 18

    Returning a Product for Service..... 19

    Technical Support..... 19

    Warranty ..... 20






    Certifications..... 20

# Safety Instructions

Follow these instructions to keep the probe operating in a correct and safe condition. Observe generally accepted safety procedures in addition to the precautions specified here. **The overall safety of any system incorporating this accessory is the responsibility of the assembler of the system.**

## Symbols

These symbols appear on the probe body or in documentation to alert you to important safety considerations.

	<b>CAUTION</b> , possibility of electric shock.
	<b>CAUTION</b> of damage to probe or instrument, or <b>WARNING</b> of hazard to health. Attend to the accompanying information to protect against personal injury or damage. Do not proceed until conditions are fully understood and met.
	Do not apply around or remove from <b>UNINSULATED HAZARDOUS LIVE</b> conductors which may render electric shock, electric burn, or arc flash.
	Equipment protected by double insulation or reinforced insulation.
	<b>CAUTION</b> , hot surface.

## Precautions

 Comply with the following safety precautions to avoid personal injury or damage to your equipment:

**Use only as specified.** The probe is intended to be used only with compatible Teledyne LeCroy instruments. Using the probe and/or the equipment it is connected to in a manner other than specified may impair the protection mechanisms.

**Do not use the probe for measurements on Mains circuits.** The probe should only be applied around or removed from insulated limited energy circuit conductors that are not directly connected to the mains.

**Do not overload; observe all ratings.** To avoid electric shock or fire, do not connect the current probe to any wire that carries voltages or currents that exceed the ratings of the probe.

**Connect and disconnect properly.** Connect the probe to the test instrument before connecting to the circuit/conductor being measured. Avoid damaging the cable through excessive bending.

**Never install or remove the probe on bare conductors which are energized.** The transformer core and shield are grounded but not insulated and may contact the conductor when the locking lever is open.

**Be careful not to damage the insulation surface** when making measurements. Before clamping to the conductor being measured, check that the insulation on the conductor is undamaged, and take care not to damage the insulation when clamping the conductor. Any damage to the insulation could cause an electric shock.

**Use only indoors and within the operational environment listed.** Do not use in wet or explosive atmospheres.

**Do not remove the probe's casing.** Touching exposed connections may result in electric shock.

Keep product surfaces clean and dry.

**Comply with the maximum input current vs. frequency derating** when measuring current that includes a high frequency component. Using the probe at high frequencies or in strong magnetic fields may cause the device to become abnormally hot, resulting in fire, equipment damage or burns.

**Do not operate with suspected failures.** Before each use, inspect the probe and accessories for any damage such as tears or other defects in the probe body, cable jacket, accessories, etc. If any part is damaged, cease operation immediately and sequester the probe from inadvertent use.

**NOTE:** Depending on the amplitude and frequency of the current being measured, the sensor head may emit a resonant sound. This sound may also occur during demagnetizing operation, but it does not represent a malfunction (device failure).



## Introduction

The CP030, CP030A, CP031, and CP031A current probes are designed for easy, highly accurate current measurements. The compact probes offer wide bandwidth with over-current protection. The probes utilize a combination of Hall-effect and transformer technology which enables measurements to be made on DC, AC and impulse currents.

The CP030 and CP030A have a 50 MHz bandwidth and are designed to measure continuous currents up to 30 Amp. The CP030-3M probe has a 10 MHz bandwidth and is designed to measure continuous currents up to 30 Amp.

**NOTE:** All CP030A probes, regardless of cable length, will indicate default probe bandwidth of 50 MHz in the Attributes section of the Probe dialog.

The CP031 and CP031A have a 100 MHz bandwidth and are designed to measure continuous currents up to 30 Amp.

The CP03x probes are compatible with most Teledyne LeCroy MAUI® oscilloscopes with a ProBus interface running Windows XP Professional® or later.

The CP03xA probes are compatible with most Teledyne LeCroy MAUI oscilloscopes with a ProBus interface running MAUI (X-StreamDSO) firmware version 7.8.x.x or later.

**NOTE:** CP03xA probes are not supported for use with the AP-1M adapter to achieve 1 M $\Omega$  coupling.

See the product page at [teledynelecroy.com/probes](http://teledynelecroy.com/probes) for compatibility, or contact your local service center. Your oscilloscope may be made compatible with the probes with appropriate software upgrades.

With the ProBus interface, the probe becomes an integral part of the measuring instrument. The bandwidth limit, Auto Zero and Degauss functions are all controlled from the instrument's touch screen user interface. The interface provides power to the probe, so no external power supply is needed.

# Specifications

For the most current specifications, see the probe product pages at [teledynelecroy.com](http://teledynelecroy.com). Specifications are subject to change without notice.

## Warranted Characteristics

	CP030/CP030-3M	CP030A	CP031	CP031A
Amplitude Accuracy	±1.0 % of reading to 30 Arms (45 to 65 Hz) ±2.0% of reading to 50 Apeak		±1.0 % of reading to 30 Arms (45 to 65 Hz) ±2.0% of reading to 50 Apeak	
Bandwidth (probe only)	DC to 50 MHz/10 MHz		DC to 100 MHz	

## Nominal Characteristics

	CP030	CP030A	CP031	CP031A
Max Continuous Input Current at 0.1 V/A	30 Arms		30 Arms	
Max Peak Current	50 Apeak non-continuous		50 Apeak non-continuous	
Intended Output Load	1 MΩ		1 MΩ	
Measured Conductors	Insulated Conductors only		Insulated conductors only	
Sensitivity *	10 mA/div to 15 A/div	1 mA/div to 15 A/div	10 mA/div to 15 A/div	1 mA/div to 15 A/div
Offset Range (1x Attenuation)	N/A	±5 A	N/A	±5 A
Max Continuous Input Current at 1 V/A (100mA/div or less)	N/A	5 A	N/A	5 A

\* Values are based on oscilloscopes with 1 mV/div sensitivity. Numbers will be higher on instruments with lower sensitivity.

## Typical Characteristics

	CP030/CP030-3M	CP030A	CP031	CP031A
Output voltage	0.1 V/A	0.1 V/A & 1 V/A	0.1 V/A	0.1 V/A & 1 V/A
Sensitivity Temperature Coefficient	$\pm 2\%$ or less ( $0^{\circ}\text{C}$ to $+40^{\circ}\text{C}$ )		$\pm 2\%$ or less ( $0^{\circ}\text{C}$ to $+40^{\circ}\text{C}$ )	
Noise	2.5 mArms or less	320 $\mu\text{Arms}$ at Full BW 150 $\mu\text{Arms}$ at 20 MHz BWL	2.5 mArms or less	320 $\mu\text{Arms}$ at Full BW 150 $\mu\text{Arms}$ at 20 MHz BWL
Rise Time	$\leq 7 \text{ ns}$ / $\leq 35 \text{ ns}$		$\leq 3.5 \text{ ns}$	

## Environmental Characteristics

	CP030	CP030A	CP031	CP031A
Operating Temperature	$0^{\circ}\text{C}$ to $40^{\circ}\text{C}$		$0^{\circ}\text{C}$ to $40^{\circ}\text{C}$	
Operating RH	$\leq 80\%$ (non-condensing)		$\leq 80\%$ (non-condensing)	
Storage Temperature	$-10^{\circ}\text{C}$ to $50^{\circ}\text{C}$		$-10^{\circ}\text{C}$ to $50^{\circ}\text{C}$	
Storage RH	$\leq 80\%$ (non-condensing)		$\leq 80\%$ (non-condensing)	
Maximum Altitude	2000 m		2000 m	
Effect of External Magnetic Field	Maximum of 20 mA in a DC/60 Hz, 400 A/m magnetic field		Maximum of 5 mA in a DC/60 Hz, 400 A/m magnetic field	

## Physical Characteristics

	CP030	CP030A	CP031	CP031A
Probe Head Length	175 mm (6.9 inch)		175 mm (6.9 inch)	
Probe Head Width	18 mm (0.7 inch)		18 mm (0.7 inch)	
Probe Head Height	40 mm (1.57 inch)		40 mm (1.57 inch)	
Maximum diameter of conductors measured	5 mm (0.2 inch)		5 mm (0.2 inch)	

### Safety Ratings


Probe Designation <sup>1</sup>	Type D
Measurement Category <sup>2</sup>	No rated measurement category
Safe Voltage Rating <sup>3</sup>	Use only on fully insulated conductors
Pollution Degree <sup>4</sup>	2

#### Definitions (per IEC/EN 61010-2-032:2012)

1. Type D current probe is intended to be applied around or removed from insulated conductors.
2. No rated measurement category; not intended for measurements on circuits directly connected to the Mains supply. Not rated for measurements within Measurement Categories II, III, or IV.
3. Not rated for measurements on uninsulated conductors.
4. Pollution Degree 2 refers to operating environment where normally only dry, non-conductive pollution occurs. Temporary conductivity caused by condensation should be expected.


**NOTE:** Because of the marking requirements per safety standard EN 61010-2-032:2012 (Third Edition), the measurement category rating that was on the CPxxx probes originally certified per EN 61010-2-032:2002 (Second Edition) has been removed from the product label. However, this change does not reduce measurement capabilities or the level of protection offered by the new probe design.

**CP030/CP030A Derating Curve - Maximum Input Current vs. Frequency\***

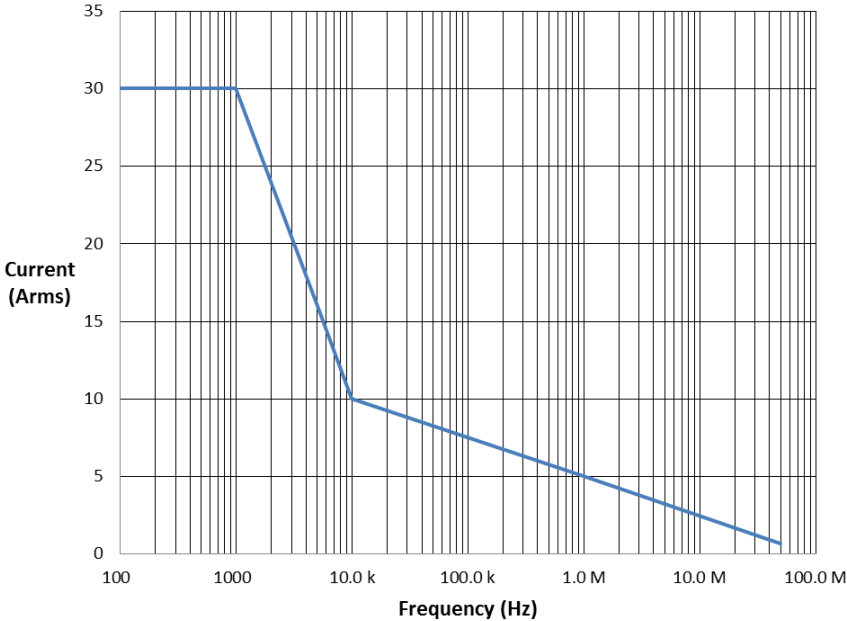


\* Does not apply to CP030-3M.

**CP030/CP030A Insertion Impedance vs. Frequency\***

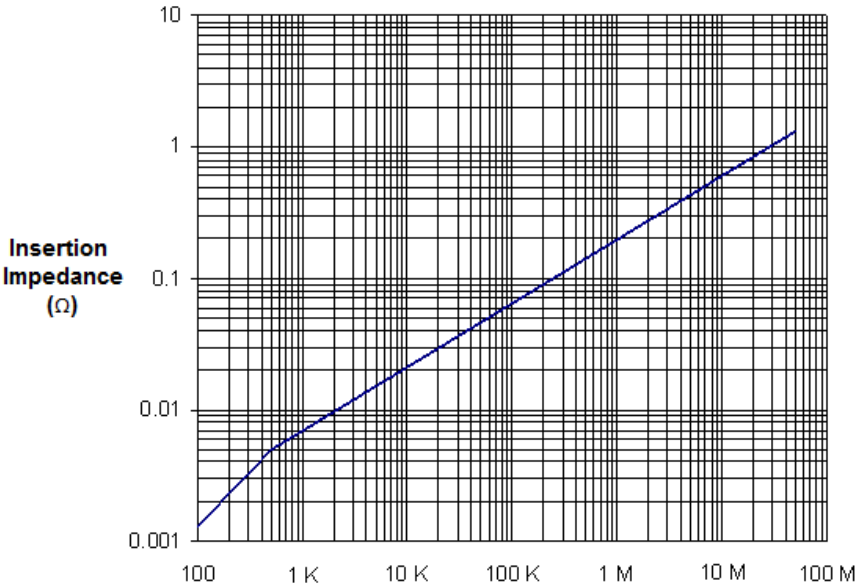


\* Does not apply to CP030-3M.

### CP031/CP031A Derating Curve - Maximum Input Current vs. Frequency

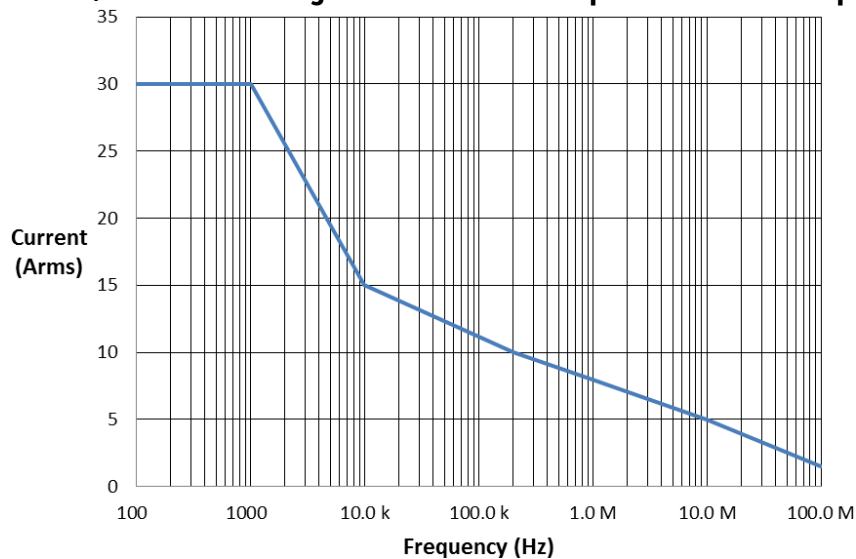

### CP031/CP031A Insertion Impedance vs. Frequency

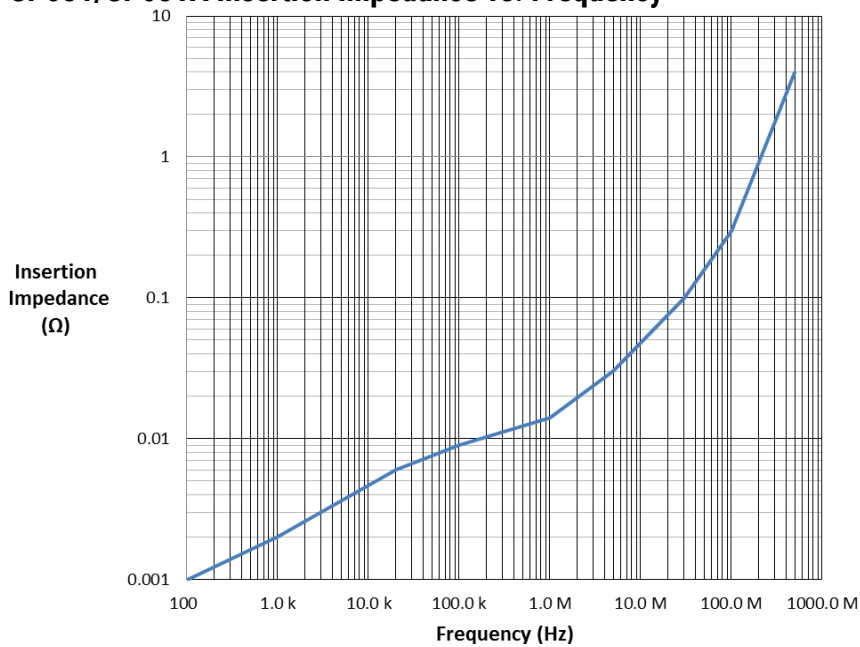

# Operation

## Precautions

The sensor head is a precision assembly consisting of a molded component with a ferrite core and a Hall effect element. It may be damaged if subjected to sudden changes in temperature, mechanical strain or shock, or application of static electricity.

The mating surfaces of the sensor are precision ground and should be treated with care. If there is any type of dust or dirt on the mating surfaces of the sensor head, measurements may be impaired.

Accurate measurements may not be possible in locations subject to strong magnetic fields such as transformers and high-current conductors, or in locations subject to strong external electric fields.



**WARNING:** Comply with the derating characteristics of the probe when measuring current that includes a high frequency component, and never measure any current that exceeds the rated current. Using the probe at high frequencies or in strong magnetic fields may cause the probe head to become abnormally hot, resulting in fire, equipment damage or burns.



**CAUTION:** Do not touch the probe head until it has had sufficient time to cool after disconnecting the probe from the circuit. Using the probe near the current and ambient temperature upper limits for extended lengths of time may cause the probe head surface to become hot to the touch.



**CAUTION:** Do not use this probe for making measurements on Mains Circuits. Using the probe on uninsulated hazardous live conductors may result in electric shock, electric burn, or arc flash.



**CAUTION:** Never use this probe on bare conductors. The core and shield are grounded and any voltage applied to the conductor may cause damage the probe or the circuit under test. **Always connect the probe to a powered on oscilloscope before clamping it to an active conductor. Failure to do so may damage the probe or test instrument.**

## **Connecting to the Test Instrument**

The probe has been designed for use with the Teledyne LeCroy instruments equipped with the ProBus interface. When you attach the probe output connector to the instrument's input connector, the instrument will:

- Recognize the probe model
- Set the input termination to 1 M $\Omega$
- Activate the probe control functions in the touch screen user interface.

## **Connecting to the Test Circuit**

The probe has been designed with a movable split core, eliminating the need to break the conductor for the core to slip around the conductor. To connect:

1. Pull back the slider so that the clamp opens.
2. Align the sensor so that the current direction indicator corresponds to the direction of current flow in the conductor.
3. Close the slider on the sensor head until the "UNLOCK" indication disappears and the "LOCK" indication appears.
4. Verify that the opening lever is firmly locked and the clamp is securely closed.




## Operating with an Oscilloscope

**NOTE:** Operation of the probe as described here requires MAUI (XStreamDSO) software version 4.3.0.0 or higher for CP03x and 7.8.x.x or higher for CP03xA. To confirm the version installed, choose Utilities > Utilities Setup from the oscilloscope menu bar, then open the Status tab.


When connected to a Teledyne LeCroy oscilloscope, the displayed scale factor and measurement values will be adjusted to account for the effective gain of the probe.

A/div, Offset, and Coupling, and Bandwidth (BWL) are controlled from the Channel setup (Cn) dialog.

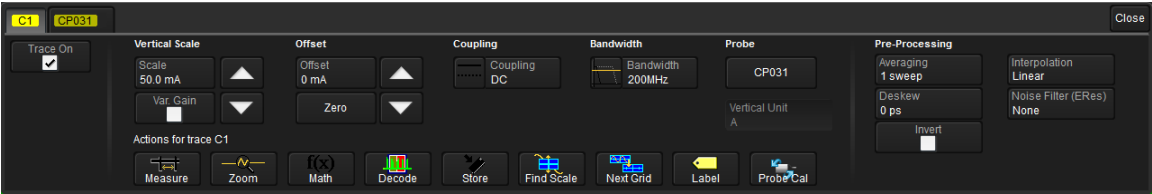

Channel setup dialog with Probe dialog behind it.

The probe's attributes are shown on the Probe dialog, which appears behind the Channel dialog when a probe is detected. The Probe dialog also contains controls for Auto Zero and Degauss.

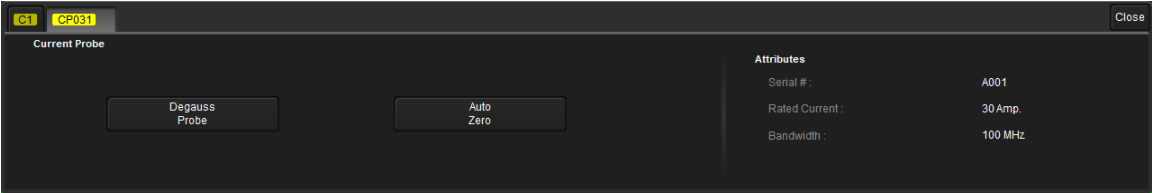

Probe dialog.

### Probe A/div and Attenuation

The front panel Volts/div knob controls the oscilloscope's scale factor and the probe's internal attenuation to give full available dynamic range from 10 mA/div to 15 A/div for CP030 and CP031, or 1 mA/div to 15 A/div for CP030A and CP031A. CP031A and CP031A will automatically adjust attenuation based on the A/div setting.

Alternatively, A/div may be controlled from the channel setup dialog (Cn).

### Bandwidth Limit

The probe is capable of switching from Full (maximum bandwidth) to 20 MHz bandwidth by changing the Bandwidth setting on the Cn dialog.

### ***AC Coupling***

In general, using offset to adjust a DC current on the screen is the preferred method to measure transient signals in the presence of a larger DC currents. The offset has limits that will cause a signal that is beyond the linear operating range of the probe to go off the screen, preventing measurement errors.

There are times, however, when it is convenient to use AC coupling to remove the DC component of the measured signal from the measurement. Selecting AC uses the scope AC coupling at the probe output to remove any steady state value from the displayed voltage.

**NOTE:** Since this AC coupling is on the probe output, DC current beyond the linear range of the probe will cause the probe to saturate and make the displayed waveform inaccurate. It is important not to exceed the maximum linear input values when using AC coupling. The maximum DC input current is 30 A when the probe is in 0.1 V/A sensitivity ( $>100$  mA/div), and 5A when the probe is in 1 V/A ( $\leq 100$  mA/div).

### ***Auto Zero***

The Probe dialog incorporates an Auto Zero function to remove the DC offset from the current probe. Auto Zero must be invoked by the user. After several minutes of warm-up, or when the probe is exposed to a large shift in ambient temperature, some DC offset drift may occur. Open the Probe dialog and touch **AUTO ZERO**.

### ***Degauss***

If the probe has been magnetized by external magnetic field or by excessive input, the core can be demagnetized by degaussing. The demagnetizing process takes about 5 seconds and should always be performed before taking a measurement.

Without clamping the probe around a conductor, slide the opening lever to close and lock the probe. Open the Probe dialog and touch **DEGAUSS**.

An Auto Zero is automatically performed as part of the degauss cycle.

## Performance Verification

This procedure can be used to verify the warranted characteristics of the probe. The recommended calibration interval for the models CP030, CP030-3M, CP030A, CP031, and CP031A Current Probes is one year. The complete performance verification procedure should be performed as the first step of annual calibration. Performance verification can be completed without removing the probe covers or exposing the user to hazardous voltages. Test results can be recorded on a photocopy of the Test Record provided at the end of the manual.

The warranted characteristics of the probe are valid at any temperature within the Environmental Characteristics listed in the Specifications. However, some of the other test equipment used to verify the performance may have environmental limitations required to meet the accuracy needed for the procedure. Make sure that the ambient conditions meet the requirements of all the test instruments used in his procedure.

## Test Equipment Required

The following table lists the required test equipment and accessories (or their equivalents). Because the input and output connector types may vary on different brands and models of test instruments, additional adapters or cables may be required.

Description	Minimum Requirements	Example Equipment
Wide Band Oscilloscope	200 MHz bandwidth ProBus interface equipped	Teledyne LeCroy WaveRunner 6 Zi
Digital Multimeter (2)	DC: 0.1% Accuracy 5½ digit resolution	Agilent Technologies 34401A Fluke 8842A-09
Function Generator	50 Hz sine wave output 3 Vrms into 50Ω	Teledyne LeCroy WaveStation 3082 Stanford Research Model DS340
Calibration Fixture	100 turn loop in series with 0.5Ω ±0.1% resistor with sense terminals	Teledyne LeCroy CP031-CF02
Calibration Fixture	ProBus Extension Cable	Teledyne LeCroy PROBUS-CF01
Banana Plug Adapter	Female BNC to Dual Banana Plug	Pomona 1269
Patch Cables (4)	Male Banana to Male Banana, 12"	Pomona B-12-0 (black) Pomona B-12-2 (red)
BNC Adapter	BNC Male to Dual Banana Jack	Pomona 1296

### Preliminary Procedure


1. Connect the probe to the C1 input of the instrument and completely close the probe slider.
2. Turn on the instrument and allow at least 30 minutes warmup time for the probe before performing the verification procedure.
3. Turn on the other test equipment and allow these to warm up for the time recommended by the manufacturer.
4. While the instruments are reaching operating temperature, make a photocopy of the Performance Verification Test Record and fill in the necessary data.

### Functional Check

The functional check will verify the basic operation of the probe functions. It is recommended to perform the functional check prior to the performance verification procedure.

1. Open the C1 setup dialog and confirm that the bandwidth is set to **Full** (BWL OFF).
2. Verify that the probe is sensed and the probe dialog (**CP03x** or **CP03xA tab**) appears behind the C1 setup dialog.
3. Open the probe dialog and degauss the probe by touching **DEGAUSS**, then **OK**.
4. Confirm that the message "**Performing Degauss on CP03x....**" is displayed in the message bar and that no error messages are displayed.

## Check LF Accuracy

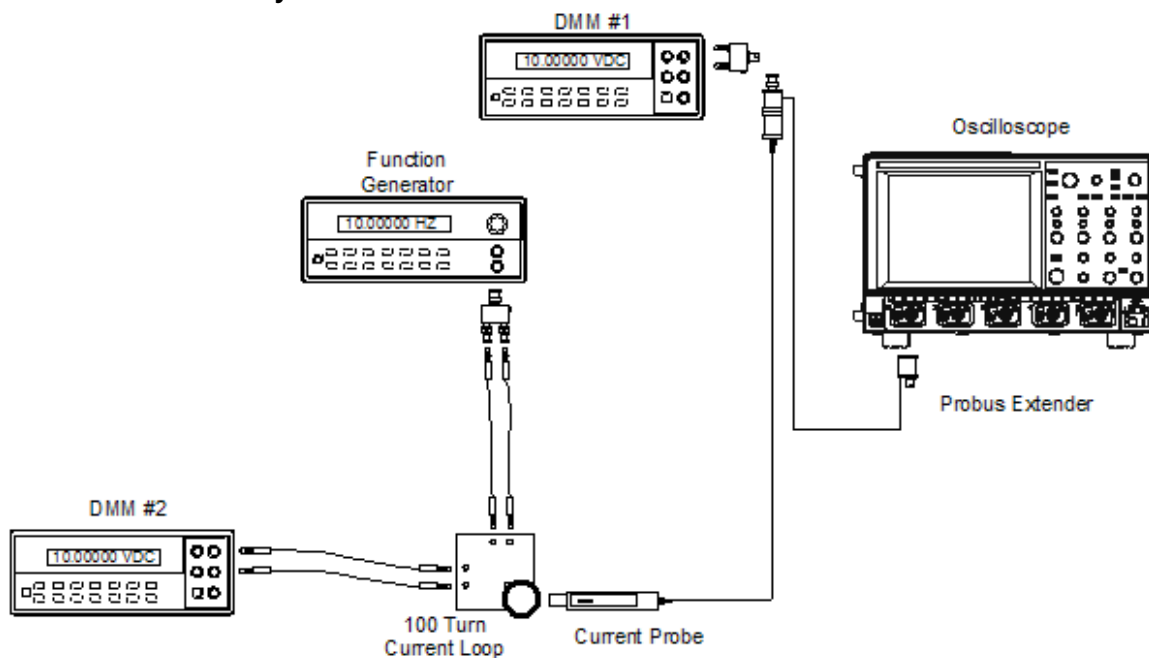

*LF Accuracy Test set up.*

1. Set the Function generator to 50 Hz sine wave, output voltage at 3 Vrms with 50 $\Omega$  output.
2. Remove the probe from the instrument and reconnect using the ProBus extension cable. Connect the BNC male connector of the ProBus extension to DMM #1 using a BNC Female to Dual Banana adapter.
3. Using Banana Patch cords and the BNC to Dual Banana Plug adapter, connect the 'V Source' and 'V Return' terminals of the 100 Turn Calibration Loop to the output of the Function Generator.
4. Connect the Current Sense terminals of the 100 Turn Calibration Loop to the voltage inputs of DMM #2.
5. Set both DMMs to measure AC Volt.
6. With the probe removed from any signal and the slider returned to the LOCKED position, degauss the probe by pressing the **DEGAUSS** button.
7. Set the current probe channel sensitivity to 1 A/div.

## **CP030/CP030A and CP031/CP031A Current Probes**

---

8. Open the probe slider and position the probe input around the 100 Turn loop. Close and LOCK the slider.
9. Adjust the Function generator voltage until the voltage measured at the 'Current Sense' terminals (DMM #2) reads  $50 \text{ mV} \pm 0.05 \text{ mV}$ . (This corresponds to 10 A at the probe head).
10. Record the voltage measured by DMM #1 on the Test Record.
11. Verify that the measured voltage is between 0.989 volt and 1.011 volt.

# CP03x Test Record

Model: \_\_\_\_\_

Serial Number: \_\_\_\_\_

Asset/Tracking Number: \_\_\_\_\_

Date: \_\_\_\_\_

Technician: \_\_\_\_\_

Equipment	Model	Serial Number	Calibration Due Date
Digital Multimeter #1			
Digital Multimeter #2			
Function Generator*			N/A

\* The function generator is used for making relative measurements. The output of the generator is measured with a DMM or oscilloscope. Thus, the generator is not required to be calibrated.

Step	Description	Intermediate Data	Test Result
10	Probe Output (limit: 0.989 – 1.011 V)		_____ V

Permission is granted to photocopy this page and record the results of the performance verification procedure on the copy. File the completed record as required by applicable internal quality procedures.

Results recorded under "Test Result" are the actual specification limit check. The test limits are included in all of these steps. Record other measurements and intermediate calculations that support the limit check under "Intermediate Data".

# Care and Maintenance

## Cleaning

The exterior of the probe and cable should be cleaned only using a soft cloth moistened with water or isopropyl alcohol. The use of abrasive agent, strong detergents or other solvents may damage the probe.



**CAUTION:** The probe casing is not sealed and should never be immersed in any fluid.

---

## Calibration Interval

The recommended calibration interval is one year. Adjustment should only be performed by qualified personnel. (A performance verification procedure is included in this manual.)

## Service Strategy

Defective probes must be returned to a Teledyne LeCroy service facility for diagnosis and exchange. A defective probe under warranty will be replaced with a factory refurbished probe. A probe that is not under warranty can be exchanged for a factory refurbished probe. A modest fee is charged for this service. A defective probe must be returned in order to receive credit for the probe core.

## Troubleshooting

If the probe is not operating properly the problem may be the way in which it is used. Before assuming the probe is defective, perform the following troubleshooting procedures:

1. Verify the test instrument is running the required MAUI (XStreamDSO) firmware (4.3.0.0 or higher for CP030/CP031 and 7.7.1.Xa or higher for CP030A/CP031A).
2. If the waveform is inverted, check that the arrow on the slider is in the direction of the current flow.
3. If there is no signal, check that the slider is closed and locked.



## Returning a Product for Service

Contact your local Teledyne LeCroy service center for calibration or other service. If the product cannot be serviced on location, the service center will give you a Return Material Authorization (RMA) code and instruct you where to ship the product. All products returned to the factory must have an RMA.

**Return shipments must be prepaid.** Teledyne LeCroy cannot accept COD or Collect shipments. We recommend air freighting. Insure the item you're returning for at least the replacement cost.

1. Remove all accessories from the probe.
2. Pack the probe in its case. If possible, include all tips. Do not include the manual.
3. Pack the case in its original shipping box, or an equivalent carton with adequate padding to avoid damage in transit.
4. Mark the outside of the box with the shipping address given to you by Teledyne LeCroy. Be sure to add the following:
  - ATTN:<RMA code assigned by Teledyne LeCroy>
  - FRAGILE
5. **If returning a probe to a different country:** contact Teledyne LeCroy Service for instructions on completing your import/export documents.

Extended warranty, calibration and upgrade plans are available for purchase. Contact your Teledyne LeCroy sales representative to purchase a service plan.

## Technical Support

For a complete list of offices by country, including our sales & distribution partners, visit:  
[teledynelecroy.com/support/contact](http://teledynelecroy.com/support/contact)

Teledyne LeCroy  
700 Chestnut Ridge Road  
Chestnut Ridge, NY, 10977, USA

### US Service and Support:

Ph: 800-553-2769 / 845-425-2000

FAX: 845-578-5985

[customersupport@teledynelecroy.com](mailto:customersupport@teledynelecroy.com)

### Warranty

THE WARRANTY BELOW REPLACES ALL OTHER WARRANTIES, EXPRESSED OR IMPLIED, INCLUDING BUT NOT LIMITED TO ANY IMPLIED WARRANTY OF MERCHANTABILITY, FITNESS, OR ADEQUACY FOR ANY PARTICULAR PURPOSE OR USE. TELEDYNE LECROY SHALL NOT BE LIABLE FOR ANY SPECIAL, INCIDENTAL, OR CONSEQUENTIAL DAMAGES, WHETHER IN CONTRACT OR OTHERWISE. THE CUSTOMER IS RESPONSIBLE FOR THE TRANSPORTATION AND INSURANCE CHARGES FOR THE RETURN OF PRODUCTS TO THE SERVICE FACILITY. TELEDYNE LECROY WILL RETURN ALL PRODUCTS UNDER WARRANTY WITH TRANSPORT PREPAID.

The product is warranted for normal use and operation, within specifications, for a period of one year from shipment. Teledyne LeCroy will either repair or, at our option, replace any product returned to one of our authorized service centers within this period. However, in order to do this we must first examine the product and find that it is defective due to workmanship or materials and not due to misuse, neglect, accident, or abnormal conditions or operation.

Teledyne LeCroy shall not be responsible for any defect, damage, or failure caused by any of the following: a) attempted repairs or installations by personnel other than Teledyne LeCroy representatives, or b) improper connection to incompatible equipment, or c) for any damage or malfunction caused by the use of non-Teledyne LeCroy supplies. Furthermore, Teledyne LeCroy shall not be obligated to service a product that has been modified or integrated where the modification or integration increases the task duration or difficulty of servicing the oscilloscope. Spare and replacement parts, and repairs, all have a 90-day warranty.

Products not made by Teledyne LeCroy are covered solely by the warranty of the original equipment manufacturer.

### Certifications

For the full list of current certifications, see the EC Declaration of Conformity shipped with your product.



The probe is marked with this symbol to indicate that it complies with the applicable European Union requirements to Directives 2012/19/EU on Waste Electrical and Electronic Equipment (WEEE).



For more information about proper disposal and recycling of your Teledyne LeCroy product, visit [teledynelecroy.com/recycle](http://teledynelecroy.com/recycle).

Unless otherwise specified, all materials and processes are compliant with RoHS Directive 2011/65/EU in its entirety, inclusive of any further amendments or modifications of said Directive.



933272-00 Rev A  
May, 2021