

Handheld Digital Multimeter

GDM-541/533

USER MANUAL

5 Commonwealth Ave
Woburn, MA 01801

TestEquipmentDepot.com



ISO-9001 CERTIFIED MANUFACTURER

GW INSTEK

This manual contains proprietary information, which is protected by copyright. All rights are reserved. No part of this manual may be photocopied, reproduced or translated to another language without prior written consent of Good Will company.

The information in this manual was correct at the time of printing. However, Good Will continues to improve products and reserves the rights to change specification, equipment, and maintenance procedures at any time without notice.

Table of Contents

SAFETY INSTRUCTIONS	4
GETTING STARTED	7
GDM-541/533 Overview	8
Function Dial and Function Buttons	12
OPERATION	14
Operating Instructions	15
AC Voltage Measurement	15
DC Voltage Measurement	17
AC/DC Millivolt Voltage Measurement	19
LoZ (low impedance) ACV Measurement (GDM-533)	21
Resistance Measurement	23
Continuity Test	25
Diode Test	27
Capacitance Measurement	29
Transistor Magnification (hFE) Measurement (GDM-541)	31
Frequency/Duty Ratio Measurement	32
Temperature Measurement (GDM-533)	33
AC/DC Current Measurement	35
Non-Contact Voltage (NCV) Detection	37
USB Data Transmission	39
Others	40
SPECIFICATIONS	41
General Specifications	41
Electrical specifications	42
MAINTENANCE	55
General Meintenance	55
Battery/Fuse Replacement	56

S SAFETY INSTRUCTIONS

This chapter contains important safety instructions that you must follow during operation and storage. Read the following before any operation to ensure your safety and to keep the instrument in the best possible condition.

Electrical Symbols

These safety symbols may appear in this manual or on the instrument.



Warning or Caution



Caution, possibility of electric shock



Both direct and alternating current



Equipment protected throughout by DOUBLE INSULATION or REINFORCED INSULATION



Earth (ground) Terminal



Complies with European Union standards

CAT III


It is applicable to testing and measuring circuits connected to the distribution part of the building's low-voltage MAINS installation.

CAT IV It is applicable to testing and measuring circuits connected at the source of the building's low-voltage MAINS installation.

Safety Instructions

The meter is designed and manufactured according to IEC61010-1 safety standard, and conforms to CAT III 1000V, CAT IV 600V, and pollution degree 2. If the meter is used in a manner not specified by the manufacturer, the protection provided by the meter may be impaired.

- Before use, please check if there is any item which is damaged or behaving abnormally. If any abnormal item (such as bare test lead, damaged meter casing, broken LCD, etc.) is found, please do not use the meter.
- Do not use the meter if the rear cover or the battery cover is not completely covered up, or it may pose a shock hazard!
- Damaged test leads must be replaced with ones of the same model or same electrical specifications.
- During measurement, do not touch any exposed wires, connectors, unused inputs or circuits being measured.
- Use caution when working with voltages above AC 30Vrms, 42Vpeak or DC 60V. Keep fingers behind the finger guards of the test leads to prevent electric shock.
- If the range of the measured value cannot be determined, the meter must be operated at the maximum range.
- Do not apply more than the rated voltage or current marked on the meter between the terminals or between any terminal and earth ground.

- Place the function dial in the correct position before measurement.
- Before measuring resistance, diode, continuity, or capacitance, switch off the power supply of the circuit, and fully discharge all capacitors.
- Before measuring current, make sure the fuses are intact.
- Do not use or store the meter in high temperature, high humidity, flammable, explosive, or strong magnetic field environments.
- Do not change the internal circuit of the meter to avoid damage to the meter or user!
- When “ ” is displayed, please replace the batteries in time to ensure measurement accuracy.
- Turn off the meter in time after measurement. If the meter is not in use for a long time, please remove the batteries.

GETTING STARTED

This chapter describes the GDM-541/533 in a nutshell, including its main features and front / rear panel introduction.



GDM-541



GDM-533

GDM-541/533 Overview	8
Overview	8
Accessories	8
External Structure	9
LCD Display	10
Function Dial and Function Buttons	12
Function Dial	12
Function Buttons	13

GDM-541/533 Overview

Overview


The GDM-541/533 is a handheld true RMS digital multimeter with high reliability and security (GDM-533: 6000 counts; GDM-541: 22000 counts). With large screen, high resolution analog pointer display, full scale overload protection, and unique appearance design, it becomes a new practical electrical measuring meter. The meter can measure AC/DC voltage/current, resistance, diode, transistor hFE (GDM-541), continuity, capacitance, frequency, duty ratio, temperature (GDM-533), etc. Featuring data transmission, data hold, relative value measurement, peak measurement, internal temperature alarm, low battery indication, backlight, auto power off, and NCV functions, the meter is an ideal measuring tool for many application fields.

Accessories

Before using the GDM unit, check the package contents to make sure all the accessories are included.


Standard Accessories	Description
	User manual*1 pc
	Test leads*1 pair
	Adapter socket*1 pc
	K-type thermocouple (GDM-533)*1 pc
	USB cable*1 pc
	1.5V AAA batteries*4

External Structure

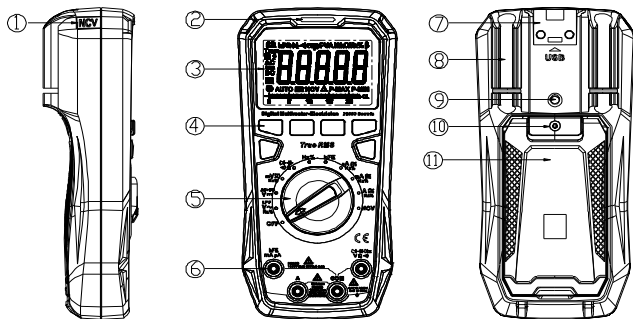


Item Index	Description
1	NCV detector
2	Indicator light
3	LCD display
4	Function buttons
5	Function dial
6	Input terminals
7	USB access port
8	Test lead slots
9	Nut for external holder
10	Battery compartment fixing screw
11	Tilt stand

LCD Display

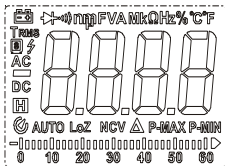

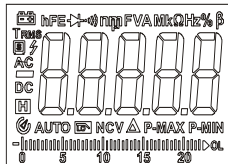

GDM-533



GDM-541

Symbol	Description
	Measured voltage is >30V (AC or DC)
	Data hold
	Negative reading
AC/DC	AC/DC measurement
	Low battery indication
AUTO	Auto range
	Diode test
	Continuity test
Δ	Relative value measurement
k Ω , M Ω , Ω	Resistance units: ohm, kilohm, megaohm
mV, V	Voltage units: millivolt, volt
μ A, mA, A	Current units: microampere, milliampere, ampere
nF, μ F, mF	Capacitance units: nanofarad, microfarad, millifarad
Hz, %	Frequency, duty ratio
	Low pass filter








	Data transmission
β	Transistor magnification (GDM-541)
NCV	Non-contact voltage detection
P-MAX/P-MIN	Peak measurement
MAX/MIN	Maximum/Minimum measurement
°C/°F	Celsius/Fahrenheit (GDM-533)
LoZ	Low impedance measurement (GDM-533)
hFE	Transistor magnification measurement (GDM-541)
	Auto power off
T _{RMS}	True RMS

Function Dial and Function Buttons

 Function Dial

Dial Position	Description
OFF	Power off
LPF V~ Hz%	AC voltage measurement/Low pass filter measurement/Frequency and duty ratio measurement (GDM-541)
AC+DC V—	DC voltage measurement/AC+DC measurement (GDM-541)
V~ Hz%	AC voltage measurement/Frequency
V~ Hz%	AC/DC voltage measurement/Frequency and duty ratio measurement (GDM-533)
mV~ Hz%	AC/DC millivolt voltage measurement/Frequency and duty ratio measurement
·) Ω ▶←	Diode test/Continuity test/Resistance measurement/Capacitance measurement
hFE	Transistor magnification measurement (GDM-541)
Hz%	Frequency and duty ratio measurement
μA ≈ Hz%	AC/DC microampere current measurement/Frequency and duty ratio measurement
mA ≈ Hz%	AC/DC milliamperere current measurement/Frequency and duty ratio measurement
A ≈ Hz%	AC/DC ampere current measurement/Frequency and duty ratio measurement
NCV	Non-contact voltage detection



Function Buttons

Button	Description
	Short press to switch between functions in each compound function position.
	Short press to enter the manual range mode and change the range. Long press to exit the manual range mode.
	Short press to switch between frequency and duty ratio measurement. Long press to turn on/off data communication (note: only available when USB communication module is inserted into the casing).
	Short press to enter/exit the relative value measurement mode.
	Short press to cycle through the measured maximum and minimum. Long press to cycle through the peak maximum and peak minimum
	Short press to hold the measurement on the display and “  ” will be displayed. Short press again to cancel data hold. Long press to turn on/off the backlight.

PERATION


Operating Instructions	15
AC Voltage Measurement	15
DC Voltage Measurement	17
AC+DC Voltage Measurement (GDM-541)	18
AC/DC Millivolt Voltage Measurement	19
LoZ (low impedance) ACV Measurement (GDM-533)	21
Resistance Measurement.....	23
Continuity Test	25
Diode Test	27
Capacitance Measurement.....	29
Transistor Magnification (hFE) Measurement (GDM- 541)	31
Frequency/Duty Ratio Measurement.....	32
Temperature Measurement (GDM-533)	33
AC/DC Current Measurement	35
Non-Contact Voltage (NCV) Detection	37
USB Data Transmission	39
Others	40

Operating Instructions

Please check the internal batteries first. If “” is displayed, replace the batteries in time. Please also pay attention to the warning sign “” beside the input terminals, which indicates that the measured voltage or current must not exceed the values marked on the meter.

AC Voltage Measurement

Wire Connection Diagram

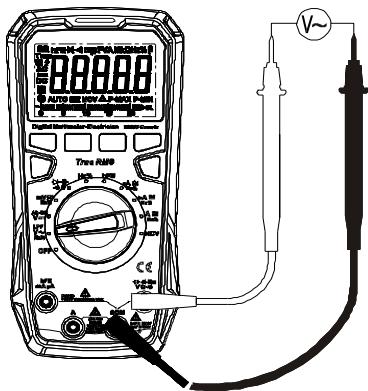

Steps of Measurement

1. Insert the red test lead into the $\overset{\text{AC}}{\text{V}} \Omega \sim$ or $\overset{\text{AC}}{\text{V}} \Omega \sim \text{C}$ terminal, and black test lead into the COM terminal.
2. Turn the function dial to the $\text{V} \sim$, $\text{V} \sim \text{Hz} \%$, or $\text{LPF} \text{V} \sim \text{Hz} \%$ position.

3. Short press the SELECT button to switch to AC voltage measurement or LPF ACV measurement (GDM-541, manual maximum range by default) if required.
4. Connect the test leads with the measured load or power supply in parallel.
5. Read the voltage value on the display (if the voltage is >1000V, the red indicator light will be on and the buzzer will sound an alarm).
6. Short press the $\frac{\text{Hz}\%}{\text{USB}}$ button to display the frequency/duty ratio of the measured voltage.




Caution

- Do not input a voltage over 1000V or it may damage the meter.
- Be cautious to avoid electric shock when measuring high voltages.
- After completing the measurement, disconnect the test leads from the circuit under test.

DC Voltage Measurement

Wire Connection Diagram

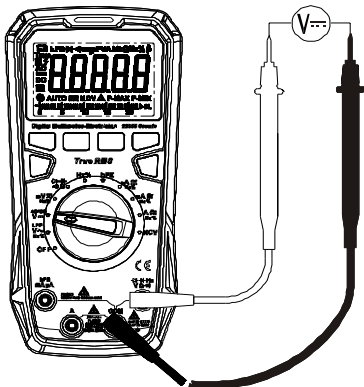

Steps of Measurement

1. Insert the red test lead into the $\text{V}\frac{\text{Hz}}{\Omega}$ or $\text{V}\frac{\text{Hz}}{\Omega}\text{ }^{\circ}\text{C}$ terminal, and black test lead into the COM terminal.
2. Turn the function dial to the $\text{V}\frac{\text{Hz}}{\Omega}$, $\text{V}\frac{\text{Hz}}{\Omega}\text{ }^{\circ}\text{C}$, or $\text{V}\frac{\text{Hz}}{\Omega}$ position.
3. Short press the SELECT button to switch to DC voltage SELECT measurement if required.
4. Connect the test leads with the measured load or power supply in parallel.
5. Read the voltage value on the display (if the voltage is $>1000\text{V}$, the red indicator light will be on and the buzzer will sound an alarm).


AC+DC Voltage Measurement (GDM-541)

Steps of Measurement

1. Insert the red test lead into the \overrightarrow{V} terminal, and black test lead into the COM terminal.
2. Turn the function dial to the $\overrightarrow{V}^{AC+DC}$ position.
3. Short press the SELECT button to switch to AC+DC voltage measurement.
4. Connect the test leads with the measured load or power supply in parallel.
5. Read the voltage values on the display. The AC and DC voltages are displayed alternately.

AC/DC Millivolt Voltage Measurement

Wire Connection Diagram

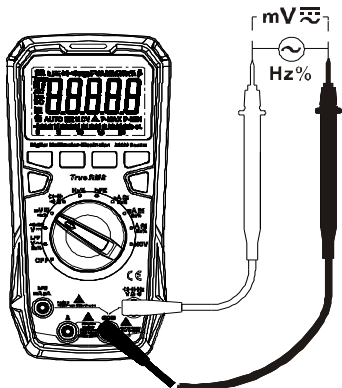

Steps of Measurement

1. Insert the red test lead into the $\text{V}\Omega\text{Hz}$ or $\text{V}\Omega\text{Hz}$ terminal, and black test lead into the COM terminal.
2. Turn the function dial to the mV position.
3. Short press the SELECT button to switch to AC/DC millivolt voltage measurement if required.
4. Connect the test leads with the measured load or power supply in parallel.
5. Read the voltage value on the display.
6. When measuring AC millivolt voltage, short press the $\text{Hz}\%$ button to display the frequency/duty ratio of the measured voltage.




Caution

- Do not input a voltage over 1000V or it may damage the meter.
- Be cautious to avoid electric shock when measuring high voltages.
- After completing the measurement, disconnect the test leads from the circuit under test.
- Before each use, verify meter operation by measuring a known voltage.
- The input impedance of the AC mV range is about 10M Ω . This load effect may cause measurement errors in high-impedance circuits. In most cases, if the impedance of the circuit is below 10k Ω , the error can be ignored ($\leq 0.1\%$).
- The input impedance of the DC mV range is infinite (about 1G Ω), and it does not attenuate when measuring weak signals, so the measurement accuracy is high. When the test leads are open, there may be a value on the screen, but this is normal and will not affect the measuring result.
- Frequency measurement at 60mV range (AC voltage) is for reference only.

LoZ (low impedance) ACV Measurement (GDM-533)

Wire Connection Diagram

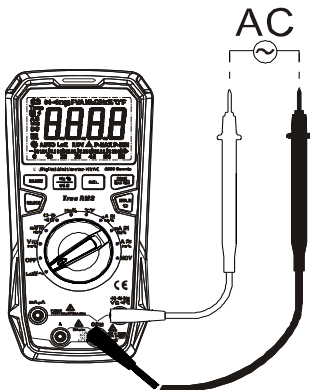

Steps of Measurement

1. Insert the red test lead into the $V\Omega Hz$ terminal, and black test lead into the COM terminal.
2. Turn the function dial to the **LoZ V~** position.
3. Connect the test leads with the measured load or power supply in parallel.
4. Read the voltage value on the display.
5. Short press the $\frac{Hz\%}{USB}$ button to display the frequency/duty ratio of the measured voltage.




Caution

- Do not input a voltage over 1000V or it may damage the meter.
- Be cautious to avoid electric shock when measuring high voltages.
- After completing the measurement, disconnect the test leads from the circuit under test.
- Before each use, verify meter operation by measuring a known voltage.
- After using the LoZ function, wait 3 minutes before next operation.
- LoZ ACV measurement eliminates ghost voltage for more accurate measurement.

Resistance Measurement

Wire Connection Diagram

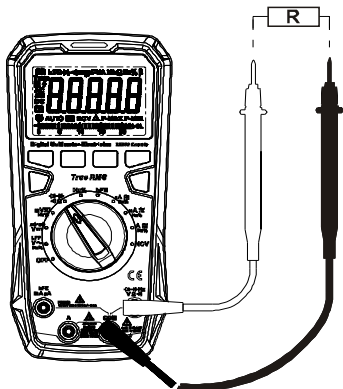

Steps of Measurement

1. Insert the red test lead into the $\text{V } \Omega \text{ Hz}$ or $\text{V } \Omega \text{ } ^\circ\text{C}$ terminal, and black test lead into the COM terminal.
2. Turn the function dial to the Ω or Ω position.
3. Touch the probes to the test points in the circuit.
4. Read the resistance value on the display.




Caution

- Use caution when working with voltages above AC 30Vrms, 42Vpeak or DC 60V. Such voltages pose a shock hazard.
- If the measured resistor is open or the resistance exceeds the maximum range, the LCD will display “OL”.
- Before measuring resistance, switch off the power supply of the circuit, and fully discharge all capacitors.
- When measuring low resistance, the test leads will produce 0.1Ω~0.3Ω measurement error. To obtain accurate measurement, short-circuit the test leads and use the relative value measurement (REL) mode.
- If the resistance is not less than 0.5Ω when the test leads are short-circuited, please check if the test leads are loose or abnormal.
- When measuring high resistance, it is normal to take a few seconds to stabilize the reading.

Continuity Test

Wire Connection Diagram

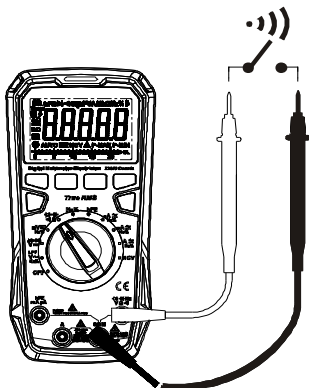

Steps of Measurement

1. Insert the red test lead into the $\text{V} \Omega \text{ Hz}$ or $\text{V} \Omega \text{ Hz} \text{ } ^\circ\text{C}$ terminal, and black test lead into the COM terminal.
2. Turn the function dial to the $\text{ } \text{ } \text{ } \Omega$ or $\text{ } \text{ } \text{ } \Omega$ position.
3. Short press the SELECT button to switch to continuity test.
4. Touch the probes to the test points in the circuit.
5. Measured resistance $< 50\Omega$: The circuit is in good conduction status; the buzzer beeps continuously and the green indicator light is on.




Caution

- Use caution when working with voltages above AC 30Vrms, 42Vpeak or DC 60V. Such voltages pose a shock hazard.
- Before testing continuity, switch off the power supply of the circuit, and fully discharge all capacitors.

Diode Test

Wire Connection Diagram

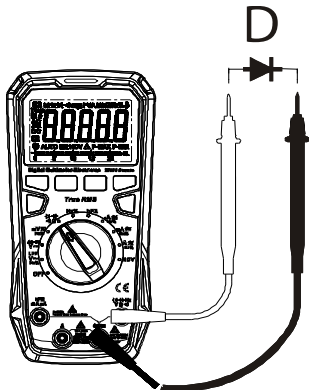

Steps of Measurement

1. Insert the red test lead into the $\text{V} \Omega \text{Hz}$ or $\text{V} \Omega \text{Hz} \text{ } ^\circ\text{C}$ terminal, and black test lead into the COM terminal.
2. Turn the function dial to the $\text{V} \leftarrow \rightarrow$ or $\text{V} \leftarrow \rightarrow$ position.
3. Short press the SELECT button to switch to diode test if required.
4. Connect the red probe with the diode anode, and black probe with the diode cathode.
5. Read the forward bias value on the display.


6. Measured value $<0.12\text{V}$: The diode may be damaged; the red indicator light is on.
Measured value within $0.12\text{V}\sim 2\text{V}$: The diode is normal; the green indicator light is on (for reference only).
7. If the diode is open or its polarity is reversed, the LCD will display "OL". For silicon PN junction, the normal value is generally about $500\sim 800\text{ mV}$.
 - Use caution when working with voltages above AC 30V_{rms} , 42V_{peak} or DC 60V . Such voltages pose a shock hazard.
 - Before testing the diode, switch off the power supply of the circuit, and fully discharge all capacitors.



Caution

Capacitance Measurement

Wire Connection Diagram

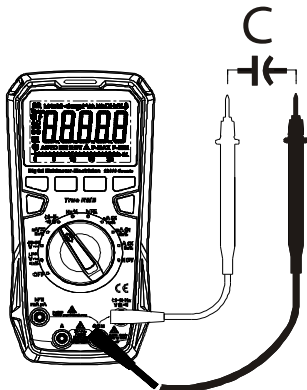

Steps of Measurement

1. Insert the red test lead into the $\text{V } \Omega \text{ Hz}$ or $\text{V } \Omega \text{ } ^\circ\text{C}$ terminal, and black test lead into the COM terminal.
2. Turn the function dial to the $\text{F} \leftarrow \rightarrow \text{F}$ or $\text{F} \leftarrow \rightarrow \Omega$ position.
3. Short press the SELECT button to switch to capacitance measurement.
4. Touch the probes to the capacitor pins.
5. Read the capacitance value on the display after it gets steady.




Caution

- Use caution when working with voltages above AC 30Vrms, 42Vpeak or DC 60V. Such voltages pose a shock hazard.
- Before measuring, fully discharge all capacitors (especially high-voltage capacitors) to avoid damage to the meter and user.
- If the measured capacitor is short-circuited or the capacitance exceeds the maximum range, the LCD will display “OL”.
- When measuring high capacitance, it is normal to take a few seconds to stabilize the reading.
- For small capacitance measurement, the REL mode should be used to avoid the influence coming from distributed capacitance so as to obtain the correct reading.

Transistor Magnification (hFE) Measurement (GDM-541)

Wire Connection Diagram

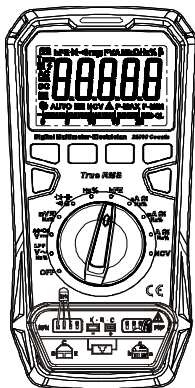


Steps of Measurement

1. Turn the function dial to the hFE position.
2. Insert the adapter socket into the input terminals.
3. Insert the three pins of the transistor under test into the corresponding holes of the adapter socket.
4. Read the magnification of the measured transistor.

Frequency/Duty Ratio Measurement

Wire Connection Diagram

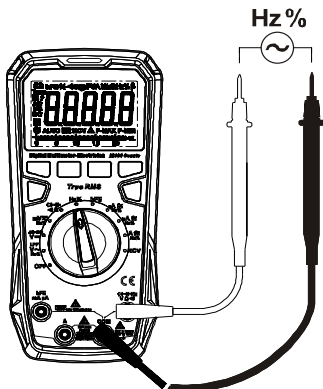

Steps of Measurement


1. Insert the red test lead into the Hz terminal, and black test lead into the COM terminal.
2. Turn the function dial to the **Hz%** position.
3. Short press the $\frac{\text{Hz\%}}{\text{USB}}$ button to switch to frequency/duty ratio measurement if required.
4. Read the frequency/duty ratio value on the display.
 - Use caution when working with voltages above AC 30Vrms, 42Vpeak or DC 60V. Such voltages pose a shock hazard.



Caution

Temperature Measurement (GDM-533)

Wire Connection Diagram

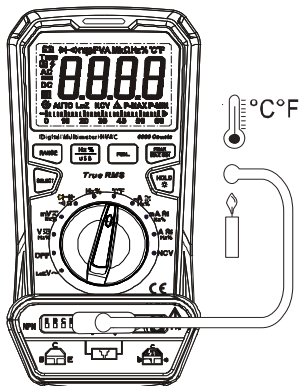

Steps of Measurement

1. Turn the function dial to the °C/°F position.
2. Insert the K-type thermocouple into the adapter socket, and then insert the adapter socket into the input terminals.
3. Bring the temperature sensing end of the thermocouple close to the object surface under test.
4. Read the Celsius temperature value on the display after it gets steady.
5. Short press the SELECT button to switch between °C and °F.




Caution

- Only K-type thermocouple is applicable.
- The LCD displays “OL” when the meter is turned on.
- The measured temperature should be less than 230°C/446°F ($^{\circ}\text{F} = ^{\circ}\text{C} \times 1.8 + 32$)

AC/DC Current Measurement

Wire Connection Diagram

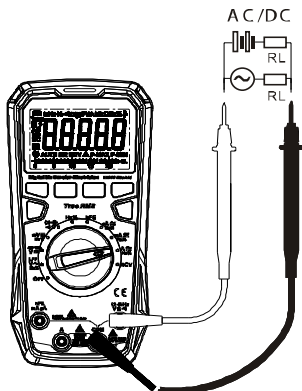

Steps of Measurement

1. Insert the red test lead into the mA/μA or A terminal, and black test lead into the COM terminal.
2. Turn the function dial to the $\frac{\mu A}{Hz}$, $\frac{mA}{Hz}$, or $\frac{A}{Hz}$ position.
3. Short press the SELECT button to switch to AC/DC current measurement if required.
4. Connect the test leads with the measured load or power supply in series.
5. Read the current value on the display (if the current is >10A, the red indicator light will be on and the buzzer will sound an alarm).




Caution

6. When measuring AC current, short press the $\frac{\text{Hz}\%}{\text{USB}}$ button to display the frequency/duty ratio of the measured current.
 - To prevent possible electric shock, fire, or personal injury, switch off the power supply of the circuit, and then connect the meter with the circuit in series before measuring the current.
 - If the range of the measured current is unknown, select the maximum range and then accordingly reduce.
 - There are fuses inside mA/ μ A and A input terminals. Do not connect the test leads with any circuit in parallel.
 - When the measured current is $>5\text{A}$, each measurement time should be $\leq 10\text{s}$ and the rest interval should be ≥ 15 minutes.
 - When the temperature in the meter is $\geq 75^\circ\text{C}$ after measurement of large current, the yellow indicator light will be on, the buzzer will beep, and the LCD will display "CUT". When the temperature drops to $< 40^\circ\text{C}$, the yellow indicator light will be off, and the measurement can be made.

Non-Contact Voltage (NCV) Detection

Wire Connection
Diagram

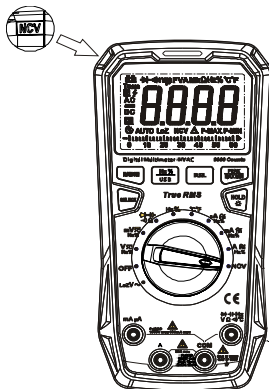

Steps of
Measurement

1. Turn the function dial to the NCV position.
2. Bring the NCV detector (top left corner of the meter) close to the wire (AC) under test.
3. If the voltage of the wire is $\geq 50V_{rms}$ (frequency: 50Hz/60Hz), the red indicator light will be on and the buzzer will beep. If no voltage is detected, the LCD will display "EF". As the intensity of the detected voltage increases, more segments "-" will be displayed, and the frequency for buzzer beeping and red indicator light flashing will be higher.



Caution

- The detected voltage level varies with the distance between the NCV detector and the wire under test.
- The detected voltage level is for reference only, not for specific measurement. The frequency of the detected voltage should be 50Hz/60Hz.
- Hold the meter casing for non-contact voltage detection.

USB Data Transmission

Wire Connection Diagram

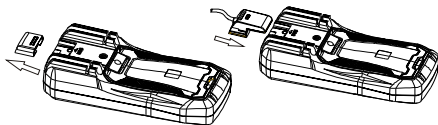


Figure A


Figure B

Steps of Measurement

1. Pull out the USB sealing cover at the back of the meter (Figure A).
2. Insert the USB communication module into the USB access port of the meter and the LCD will display "S" (Figure B).
3. If USB data transmission is not needed during measurement, long press the $\frac{\text{Hz}\%}{\text{USB}}$ button or pull out the USB module to disable data transmission, and "S" will disappear.
4. To recover this function, long press the $\frac{\text{Hz}\%}{\text{USB}}$ button or insert the USB module.
5. The USB communication software can be downloaded from the official website of GW INSTEK (www.gwinstek.com).

Others

Steps of Measurement

1. Auto power off: During measurement, if there is no operation for 15 minutes, the meter will automatically shut down to save power; before the automatic shutdown, the buzzer will beep for warning. Users can wake the meter up by pressing the SELECT button. To disable the auto-off function, press and hold the SELECT button in the off state, and then turn on the meter. To recover the function, restart the meter.
2. Buzzer alarm during measurement: When the input voltage >1000V or current >10A, the buzzer will sound an alarm.
3. Low battery indication: When the battery voltage is $\leq 4.6V \pm 0.2V$, " " will be displayed.

SPECIFICATIONS

General Specifications

- 1 Max voltage between the input terminal and COM terminal: Please refer to the description of input protection voltage for each range.
- 2 mA/ μ A input terminal protection: (CE) 600mA 1000V fast-acting fuse, Φ 6x32mm
- 3 A input terminal protection: (CE) 11A 1000V fast-acting fuse, Φ 10x38mm
- 4 Max display: 22000 (GDM-541), 6000 (GDM-533)
- 5 Analog bar: 46 segments (GDM-541) (conversion rate: 30 times/s), 31 segments (GDM-533)
- 6 Refresh rate: 2~3 times/s
- 7 Range: Auto/Manual
- 8 Polarity display: Auto
- 9 Over-range Indication: OL
- 10 Low battery indication: " " is displayed.
- 11 Operating temperature: 0°C~40°C (32°F~104°F)
- 12 Storage temperature: -10°C~50°C (14°F ~122°F)
- 13 Relative humidity: \leq 75% at 0°C~30°C; \leq 50% at 30°C~40°C
- 14 Operating altitude: \leq 2000m
- 15 Electromagnetic compatibility: Conforms to EN61326-1:2006 and EN61326-2-2:2006 standards
- 16 Battery: 4x1.5V AAA
- 17 Dimensions: 186mmx89mmx49mm
- 18 Weight: 420g (GDM-541), 400g (GDM-533) (with battery)
- 19 Safety standard: IEC 61010-1: CAT III 1000V/CAT IV 600V
- 20 Certification: CE
- 21 Pollution degree: 2
- 22 Information of usage: Indoor and outdoor

Electrical specifications

Accuracy: \pm (a% of reading + b digits), 1 year warranty

Ambient temperature: $23^{\circ}\text{C} \pm 5^{\circ}\text{C}$ ($73.4^{\circ}\text{F} \pm 9^{\circ}\text{F}$) Relative humidity: $\leq 75\%$



Caution

- To ensure measurement accuracy, the operating temperature should be within $18^{\circ}\text{C} \sim 28^{\circ}\text{C}$ and the fluctuation range should be within $\pm 1^{\circ}\text{C}$. When the temperature is $< 18^{\circ}\text{C}$ or $> 28^{\circ}\text{C}$, add temperature coefficient error: $0.1 \times (\text{specified accuracy}) / ^{\circ}\text{C}$.

Technical Specifications Index

DC Voltage	43
AC Voltage	44
AC+DC Voltage	46
Resistance	47
Continuity and Diode	48
Transistor Magnification (GDM-541)	48
Capacitance	49
Temperature (GDM-533)	50
DC Current	50
AC Current	51
Frequency/Duty Ratio	53
Indicator Light	54

DC Voltage

GDM-541		
Range	Resolution	Accuracy
220.00mV	0.01mV	$\pm (0.1\%+5)$
2.2000V	0.1mV	$\pm (0.05\%+5)$
22.000V	1mV	
220.00V	10mV	
1000.0V	0.1V	$\pm (0.1\%+5)$

GDM-533		
Range	Resolution	Accuracy
60.00mV	0.01mV	$\pm (0.8\%+5)$
600.0mV	0.1mV	$\pm (0.8\%+3)$
6.000V	0.001V	$\pm (0.5\%+3)$
60.00V	0.01V	$\pm (0.5\%+3)$
600.0V	0.1V	
1000V	1V	$\pm (1.0\%+3)$

- Input impedance: About $1G\Omega$ for mV range, about $10M\Omega$ for other ranges
- Accuracy guarantee: 1%~100% of range; short circuit allows least significant digit ≤ 5
- Max input voltage: 1000V (if the voltage is $>1000V$, the red indicator light will be on and the buzzer will sound an alarm; if the voltage is $>1010V$, the LCD will display "OL")
- Overload protection: 1000V

AC Voltage

GDM-541			
Range	Resolution	Frequency Response	Accuracy
220.00mV	0.01mV	40Hz~1kHz	$\pm (1.0\%+10)$
		1kHz~10kHz	$\pm (1.5\%+30)$
2.2000V	0.1mV	40Hz~1kHz	$\pm (0.8\%+10)$
		1kHz~10kHz	$\pm (1.2\%+50)$
		40Hz~100Hz (LPF)	$\pm (1.2\%+50)$
22.000V	1mV	40Hz~1kHz	$\pm (0.8\%+10)$
		1kHz~10kHz	$\pm (1.2\%+50)$
		40Hz~100Hz (LPF)	$\pm (1.8\%+50)$
220.00V	10mV	40Hz~1kHz	$\pm (0.8\%+10)$
		1kHz~10kHz	$\pm (2.0\%+50)$
		40Hz~100Hz (LPF)	$\pm (2.0\%+50)$
1000.0V	0.1V	40Hz~1kHz	$\pm (1.2\%+10)$
		1kHz~10kHz	$\pm (3.0\%+50)$
		40Hz~100Hz (LPF)	

GDM-533			
Range	Resolution	Frequency Response	Accuracy
60.00mV	0.01mV	40Hz~1kHz	$\pm (1.2\%+5)$
600.0mV	0.1mV	40Hz~1kHz	$\pm (1.2\%+5)$
6.000V	0.001V	40Hz~1kHz	$\pm (1.0\%+3)$
60.00V	0.01V	40Hz~1kHz	$\pm (1.0\%+3)$
600.0V	0.1V	40Hz~1kHz	$\pm (1.0\%+3)$
1000V	1V	40Hz~1kHz	$\pm (1.2\%+5)$
LoZ ACV 600.0V	0.1V	40Hz~1kHz	$\pm (2.0\%+5)$
LoZ ACV 1000V	1V	40Hz~1kHz	$\pm (2.0\%+5)$

- Input impedance: About 10M Ω
- Display: True RMS
- Frequency response: 40Hz~1kHz (GDM-533), 40Hz~10kHz (GDM-541)
- Accuracy guarantee (GDM-533): 2%~100% of 60mV range, 1%~100% of other ranges; short circuit allows least significant digit ≤ 3
- Accuracy guarantee (GDM-541): 1%~100% of range at 40Hz~1kHz, 10%~100% of range at 1kHz~10kHz; short circuit allows least significant digit ≤ 10
- The AC crest factor can be ≤ 3.0 at 3000 counts, and can only be ≤ 1.5 at 6000 counts. The additional error should be added according to the crest factor of a non-sinusoidal wave as follows (GDM-533):
 - a) Add 4% when crest factor is 1~2
 - b) Add 5% when crest factor is 2~2.5
 - c) Add 7% when crest factor is 2.5~3
- The AC crest factor can be ≤ 2.0 at 10000 counts, and can only be ≤ 1 at 22000 counts. The additional error should be added according to the crest factor of a non-sinusoidal wave as follows (GDM-541):
 - a) Add 4% when crest factor is 1~2
 - b) Add 5% when crest factor is 2~2.5
 - c) Add 7% when crest factor is 2.5~3
- Frequency measurement range: 40Hz~1kHz (GDM-533), 40Hz~10kHz (GDM-541); input amplitude: $\geq 10\%$ of voltage range Duty ratio is for reference only.
- Frequency accuracy: $\pm (0.1\%+4)$, resolution: 0.1Hz (GDM-533)
- Frequency accuracy: $\pm (0.01\%+5)$, resolution: 0.01Hz (GDM-541)
- Max input voltage: 1000V (if the voltage is $>1000V$, the red indicator light will be on and the buzzer will sound an alarm; if the voltage is $>1010V$, the LCD will display "OL")
- Overload protection: 1000V

AC+DC Voltage

GDM-541			
Range	Resolution	Frequency Response	Accuracy
2.2000V	0.1mV	40Hz~500Hz	± (1.8%+70)
22.000V	1mV	40Hz~500Hz	± (1.8%+70)
220.00V	10mV	40Hz~500Hz	± (1.8%+70)
1000.0V	0.1V	40Hz~500Hz	± (4.0%+70)

- AC voltage display: True RMS
- Input impedance: About 10M Ω
- Accuracy guarantee: 10%~100% of range
- For AC voltage, short circuit allows least significant digit ≤ 200
- Overload protection: 1000V



Resistance

GDM-541		
Range	Resolution	Accuracy
220.00Ω	0.01Ω	± (0.5+10)
2.2000kΩ	0.1Ω	
22.000kΩ	1Ω	
220.00kΩ	10Ω	
2.2000MΩ	100Ω	± (0.8+10)
22.000MΩ	1kΩ	± (1.5%+10)
220.00MΩ	10kΩ	± (3.0%+50)

GDM-533		
Range	Resolution	Accuracy
600.0Ω	0.1Ω	± (1.2%+2)
6.000kΩ	1Ω	± (1.0%+2)
60.00kΩ	10Ω	
600.0kΩ	100Ω	
6.000MΩ	1kΩ	± (1.2%+2)
60.00MΩ	10kΩ	± (2.0%+5)

- Measurement result = displayed value - resistance of shorted test leads
- Open circuit voltage: About 1V
- Accuracy guarantee: 1%~100% of range
- Overload protection: 1000V

Continuity and Diode

Range	Resolution	Remarks
	0.1Ω	Broken circuit: Resistance $\geq 70\Omega$, no beep Well-connected circuit: Resistance $< 50\Omega$, audio/visual alarm
	0.001V	Open circuit voltage: About 3V For normal diodes, the buzzer will beep once. For short circuit, the buzzer will beep for a long time.

- Overload protection: 1000V
- When the forward voltage drop is within 0.12V~2V, the buzzer will beep once. When the forward voltage drop is $< 0.12V$, the buzzer will beep for a long time.

Transistor Magnification (GDM-541)

GDM-541		
Range	Resolution	Remarks
1000β	1β	I _{b0} : About 1.8μA; V _{ce} : About 2.5V

- The displayed value of the transistor magnification is for reference only.

Capacitance

GDM-541		
Range	Resolution	Accuracy
22.000nF	1pF	± (3.0%+5)
220.00nF	10pF	
2.2000μF	100pF	
22.000μF	1nF	
220.00μF	10nF	± (4.0%+5)
2.2000mF	100nF	
22.000mF	1μF	± (10%+5)
220.00mF	10μF	± (20%+5)

GDM-533		
Range	Resolution	Accuracy
60.00nF	10pF	± (3%+5)
600.0nF	100pF	
6.000μF	1nF	
60.00μF	10nF	
600.0μF	100nF	
6.000mF	1μF	± (10%+5)
60.00mF	10μF	

- Overload protection: 1000V
- Measurement result = displayed value - capacitance of open-circuit test leads
- For capacitance $\leq 1\mu\text{F}$ (GDM-533) and $\leq 22\text{nF}$ (GDM-541), it is recommended to use the REL mode to deduct the open circuit reading.
- Accuracy guarantee: 1%~100% of range
- For ranges of $2.2\mu\text{F}$ and below, when the accuracy is $\leq 3\%$, 10 digits should be added (GDM-541).
- For ranges of 60mF (GDM-533) and 220mF (GDM-541), the measurement time is about 20s.

Temperature (GDM-533)

Range		Resolution	Accuracy
-40~1000°C	-40~0°C	0.1°C~1°C	± (1.0%+3°C)
	0~300°C		± (1.0%+2°C)
	300~1000°C		± (1.0%+3°C)
-40~1832°F	-40~32°F	0.2°F~2°F	± (1.0%+6°F)
	32~572°F		± (1.0%+4°F)
	572~1832°F		± (1.0%+6°F)

- The measured temperature should be less than 230°C/446°F.

DC Current

GDM-541		
Range	Resolution	Accuracy
220.00μA	0.01μA	± (0.5%+10)
2200.0μA	0.1μA	
22.000mA	1μA	
220.00mA	10μA	
20.000A	1mA	± (1.2%+50)

GDM-533		
Range	Resolution	Accuracy
600.0μA	0.1μA	± (1.0%+2)
6000μA	1μA	
60.00mA	10μA	± (1.0%+3)
600.0mA	0.1mA	
6.000A	1mA	± (1.2%+5)
20.00A	10mA	

- Overload protection:
mA/ μ A range: F1 Fuse 600mA 1000V Φ 6x32mm
A range: F2 Fuse 11A 1000V Φ 10x38mm
- Open circuit allows least significant digit ≤ 5 (GDM-533) and ≤ 10 (GDM-541).
- Accuracy guarantee: 1%~100% of range

AC Current

GDM-541			
Range	Resolution	Frequency Response	Accuracy
220 μ A	0.01 μ A	40Hz~1kHz	$\pm (0.8\%+10)$
		1kHz~10kHz	$\pm (3\%+50)$
2200 μ A	0.1 μ A	40Hz~1kHz	$\pm (0.8\%+10)$
		1kHz~10kHz	$\pm (3\%+50)$
22mA	1 μ A	40Hz~1kHz	$\pm (1.2\%+10)$
		1kHz~10kHz	$\pm (3\%+50)$
220mA	10 μ A	40Hz~1kHz	$\pm (1.2\%+10)$
		1kHz~10kHz	$\pm (3\%+50)$
20A	1mA	40Hz~1kHz	$\pm (1.2\%+10)$
		1kHz~10kHz	$\pm (3\%+50)$

GDM-533			
Range	Resolution	Frequency Response	Accuracy
600.0 μ A	0.1 μ A	40Hz~1kHz	$\pm (1.2\%+5)$
6000 μ A	1 μ A	40Hz~1kHz	
60.00mA	10 μ A	40Hz~1kHz	$\pm (1.5\%+5)$
600.0mA	0.1mA	40Hz~1kHz	
6.000A	1mA	40Hz~1kHz	$\pm (2.0\%+5)$
20.00A	10mA	40Hz~1kHz	

- Display: True RMS
- Frequency response: 40Hz~1kHz (GDM-533), 40Hz~10kHz (GDM-541)
- Accuracy guarantee (GDM-533): 5%~100% of 600.0 μ A range, 1%~100% of other ranges; open circuit allows least significant digit ≤ 5
- Accuracy guarantee (GDM-541): 1%~100% of range at 40Hz~1kHz, 10%~100% of range at 1kHz~10kHz (the minimum measured current at μ A ranges is 30 μ A); open circuit allows least significant digit ≤ 10
- The AC crest factor can be ≤ 3.0 at 3000 counts, and can only be ≤ 1.5 at 6000 counts. The additional error should be added according to the crest factor of a non-sinusoidal wave as follows (GDM-533):
 - a) Add 4% when crest factor is 1~2
 - b) Add 5% when crest factor is 2~2.5
 - c) Add 7% when crest factor is 2.5~3
- The AC crest factor can be ≤ 2.0 at 10000 counts, and can only be ≤ 1 at 22000 counts. The additional error should be added according to the crest factor of a non-sinusoidal wave as follows (GDM-541):
 - a) Add 4% when crest factor is 1~2
 - b) Add 5% when crest factor is 2~2.5
 - c) Add 7% when crest factor is 2.5~3
- Frequency measurement range: 40Hz~1kHz (GDM-533), 40Hz~10kHz (GDM-541); input amplitude: $\geq 50\%$ of current range. Duty ratio is for reference only.
- Frequency accuracy: $\pm (0.1\%+4)$, resolution: 0.1Hz (GDM-533)
- Frequency accuracy: $\pm (0.01\%+5)$, resolution: 0.01Hz (GDM-541)
- Overload protection: Same as that for DC current

Frequency/Duty Ratio

GDM-541		
Range	Resolution	Accuracy
10Hz~220MHz	0.01Hz~0.01MHz	$\pm (0.01\%+5)$
0.1%~99.9%	0.1%	$\pm (2\%+5)$

GDM-533		
Range	Resolution	Accuracy
10.00Hz~10.00MHz	0.01Hz~0.01MHz	$\pm (0.1\%+4)$
0.1%~99.9%	0.1%	$\pm (2\%+5)$

- Frequency input amplitude:
 - $\leq 100\text{kHz}$: $200\text{mVrms} \leq \text{input amplitude} \leq 20\text{Vrms}$
 - $> 100\text{kHz} \sim 1\text{MHz}$: $600\text{mVrms} \leq \text{input amplitude} \leq 20\text{Vrms}$
 - $> 1\text{MHz}$ (GDM-533): $1\text{Vrms} \leq \text{input amplitude} \leq 20\text{Vrms}$
 - $> 1\text{MHz} \sim 40\text{MHz}$ (GDM-541): $1\text{Vrms} \leq \text{input amplitude} \leq 20\text{Vrms}$
 - $> 40\text{MHz}$ (GDM-541): Not specified
- Duty ratio measurement is only applicable to square waves.
 - $1\text{Vpp} \leq \text{input amplitude} \leq 20\text{Vpp}$
 - Frequency $\leq 10\text{kHz}$, duty ratio: 10.0% ~ 90.0%
- Overload protection: 1000V

Indicator Light

Function	Status	Description
NCV	Off	<36V
	On, red	50V~1000V (the red indicator light flashes from slow to fast)
Continuity	Off	OL
	On, red	No continuity ($\geq 70\Omega$)
	On, green	Continuity ($< 50\Omega$)
Diode	Off	>2V
	On, red	Breakdown ($< 0.12V$)
	On, green	Conduction ($0.12V \sim 2V$)
AC/DC voltage	Off	$\leq 1000V$
	On, red	$> 1000V$
Current	Off	$\leq 10A$
	On, red	$> 10A$
Internal temperature during AC/DC current measurement	Off	The temperature in the meter drops to $< 40^{\circ}C$ after measurement of large current.
	On, yellow	The temperature in the meter is $\geq 75^{\circ}C$ after measurement of large current.

M AINTENANCE




Caution

- Before opening the rear cover or battery cover of the meter, switch off the power supply and remove the test leads.

General Maintenance

- Clean the meter casing with a damp cloth and mild detergent. Do not use abrasives or solvents!
- If there is any malfunction, stop using the meter and send it for maintenance.
- The maintenance and service must be implemented by qualified professionals or designated departments.

Battery/Fuse Replacement

- Battery: 4×1.5V AAA batteries
- Fuse: F1 Fuse 600mA 1000V Φ 6×32mm (mA/ μ A input terminal)
F2 Fuse 11A 1000V Φ 10×38mm (A input terminal)
- When “” is displayed, please replace the batteries in time to ensure measurement accuracy.
- Resistance measurement can be used to check the built-in 600mA and 11A fuses. Operation: Insert the red test lead into the $\frac{20-10-1\text{Hz}}{V\Omega-\rightarrow}$ or $\frac{20-10-1\text{Hz}}{V0-\rightarrow^{\circ}C}$ terminal. Insert the red probe into the mA/ μ A input terminal to measure the resistance. If the LCD displays “OL”, the 600mA fuse is blown. Insert the red probe into the A input terminal to measure the resistance. If the LCD displays “OL”, the 11A fuse is blown.

Steps of Replacement

1. Turn the function dial to the "OFF" position, and remove the test leads.
2. Unscrew and remove the battery cover to replace the batteries and fuses.

