


T3PM1006

Digital Power Meter

User Manual

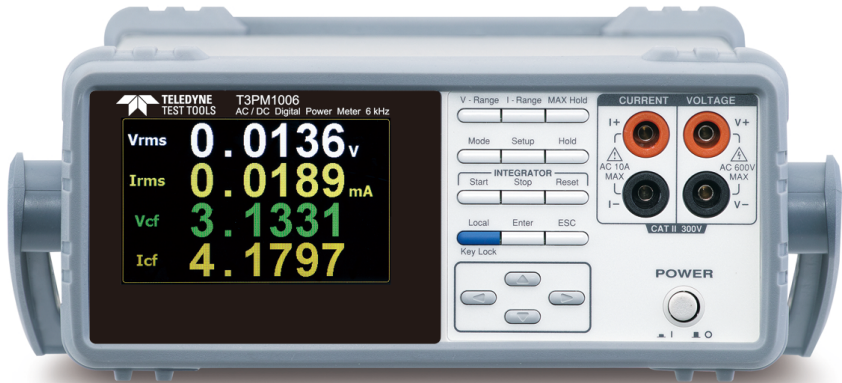

This manual contains proprietary information, which is protected by copyright. All rights are reserved. No part of this manual may be photocopied, reproduced or translated to another language without prior written consent of Teledyne LeCroy company.

The information in this manual was correct at the time of printing. However, Teledyne LeCroy continues to improve products and reserves the rights to change specification, equipment, and maintenance procedures at any time without notice.

Table of Contents

SAFETY INSTRUCTIONS	5
GETTING STARTED.....	10
Characteristics	11
Appearance	14
Set Up	23
BASIC SETTING	26
Setting up measurement range	27
Setting up measurement status	31
Setting up System status	41
MEASUREMENT AND OTHER FUNCTIONS.....	46
Measurement function.....	47
Other functions	50
Integration measurement function.....	52
REMOTE CONTROL.....	59
Configure Remote Control Interface.....	60
Return to Local Control.....	63
COMMAND OVERVIEW	64
Command Syntax	64
Command List	68
APPENDIX.....	102
Specifications	103
Dimensions	108
Power measurement	109
Introduction to IEC-62301.....	111
EUP Directive Lot6 specifications	112

Connection Guide 113

CERTIFICATIONS..... 115

 EMC Compliance 115

 Safety Compliance 117

 Environmental Compliance 118







RESTRICTION OF HAZARDOUS SUBSTANCES
(RoHS) 118

SAFETY INSTRUCTIONS

This chapter contains important safety instructions that you must follow during operation and storage. Read the following before any operation to ensure your safety and to keep the instrument in the best possible condition.

Safety Symbols

These safety symbols may appear in this manual or on the instrument.

	WARNING	Warning: Identifies conditions or practices that could result in injury or loss of life.
	CAUTION	Caution: Identifies conditions or practices that could result in damage to the T3PM1006 or to other properties.
		DANGER High Voltage
		Attention Refer to the Manual
		Protective Conductor Terminal
		Earth (ground) Terminal
1		On (Supply)
0		Off (Supply)

Safety Guidelines

General Guideline • Make sure that the voltage input level does not exceed DC848V/AC600V.



CAUTION

- Make sure the current input level does not exceed 20A.
- Do not place any heavy object on the instrument.
- Avoid severe impact or rough handling that can lead to damaging the instrument.
- Do not discharge static electricity to the instrument.
- Use only mating connectors, not bare wires, for the terminals.
- Do not block or obstruct the cooling fan vent opening.
- Do not perform measurement at the source of a low-voltage installation or at building installations (Note below).
- Do not disassemble the instrument unless you are qualified as service personnel.
- Make sure that the COM terminal to earth is limited to 300Vpk.
- Remove all test leads before disconnecting the mains power cord from the socket.
- If the equipment is used in a manner not specified by the manufacturer, the protection provided by the equipment may be impaired.
- The device should be placed in a way that the plug connected to it can be removed easily.

(Note) EN 61010-1:2010 specifies the measurement categories and their requirements as follows. The T3PM1006 falls under category II 300V.

- Measurement category IV is for measurement performed at the source of low-voltage installation.
 - Measurement category III is for measurement performed in the building installation.
 - Measurement category II is for measurement performed on the circuits directly connected to the low voltage installation.
-

Power Supply



WARNING

- AC Input voltage: 100-240 VAC 50/60Hz
 - The power supply voltage should not fluctuate more than 10%.
 - Connect the protective grounding conductor of the AC power cord to an earth ground, to avoid electrical shock.
-

Cleaning the Instrument

- Disconnect the power cord before cleaning.
 - Use a soft cloth dampened in a solution of mild detergent and water. Do not spray any liquid.
 - Do not use chemicals containing harsh material such as benzene, toluene, xylene, and acetone.
-

Operation Environment

- Location: Indoor, no direct sunlight, dust free, almost non-conductive pollution (Note below)
- Temperature: 0°C to 40°C
- Humidity: < 30°C: < 80%RH(non-condensing);
30°C~40°C:<70%RH(non-condensing);
>40°C: <50%RH (non-condensing)
- Altitude: <2000m

(Note) EN 61010-1:2010 specifies the pollution degrees and their requirements as follows. The T3PM1006 falls under degree 2.

- Pollution refers to “addition of foreign matter, solid, liquid, or gaseous (ionized gases), that may produce a reduction of dielectric strength or surface resistivity”.
 - Pollution degree 1: No pollution or only dry, non-conductive pollution occurs. The pollution has no influence.
 - Pollution degree 2: Normally only non-conductive pollution occurs. Occasionally, however, a temporary conductivity caused
-

by condensation must be expected.

- Pollution degree 3: Conductive pollution occurs, or dry, non-conductive pollution occurs which becomes conductive due to condensation which is expected. In such conditions, equipment is normally protected against exposure to direct sunlight, precipitation, and full wind pressure, but neither temperature nor humidity is controlled.
-

Storage environment

- Location: Indoor
 - Temperature: -40°C to 70°C
 - Humidity: <90%RH(non-condensing)
-

Disposal



Do not dispose this instrument as unsorted municipal waste. Please use a separate collection facility or contact the supplier from which this instrument was purchased. Please make sure discarded electrical waste is properly recycled to reduce environmental impact.

Power cord for the United Kingdom

When using the unit in the United Kingdom, make sure the power cord meets the following safety instructions.

NOTE: This lead/appliance must only be wired by competent persons




WARNING: THIS APPLIANCE MUST BE EARTHED

IMPORTANT: The wires in this lead are coloured in accordance with the following code:

Green/ Yellow:	Earth
Blue:	Neutral
Brown:	Live (Phase)



As the colours of the wires in main leads may not correspond with the coloured marking identified in your plug/appliance, proceed as follows:

The wire which is coloured Green & Yellow must be connected to the Earth terminal marked with either the letter E, the earth symbol  or coloured Green/Green & Yellow.

The wire which is coloured Blue must be connected to the terminal which is marked with the letter N or coloured Blue or Black.

The wire which is coloured Brown must be connected to the terminal marked with the letter L or P or coloured Brown or Red.

If in doubt, consult the instructions provided with the equipment or contact the supplier.

This cable/appliance should be protected by a suitably rated and approved HBC mains fuse: refer to the rating information on the equipment and/or user instructions for details. As a guide, a cable of 0.75mm² should be protected by a 3A or 5A fuse. Larger conductors would normally require 13A types, depending on the connection method used.

Any exposed wiring from a cable, plug or connection that is engaged in a live socket is extremely hazardous. If a cable or plug is deemed hazardous, turn off the mains power and remove the cable, any fuses and fuse assemblies. All hazardous wiring must be immediately destroyed and replaced in accordance to the above standard.

GETTING STARTED

This chapter describes the T3PM1006, including accessories, package contents, its main features and front / rear panel introduction.

Characteristics	11
Accessories	13
Package Contents	13
Appearance	14
Front Panel	14
Display Overview	18
Rear Panel	21
Set Up	23
Tilting the Stand	23
Power Up	24
Connect the wires to the T3PM1006	25

Characteristics

The T3PM1006 is a high-precision, programmable power meter for measuring low power devices such as switching power supplies, transformers, power supplies, and adapters. It is equipped with a color TFT-LCD screen which is very convenient for reading the measurement results. The T3PM1006 has become a reliable power measurement instruments because of its simple operation, excellent performance and automatic measurement interface.



Operation

- Press the buttons on the front panel to easily turn on the T3PM1006 measurement function. All settings and measurements results are displayed on the TFT-LCD screen panel for easy use of each function.
- Standard display mode: 2 main measurement results and 6 secondary measurement results are displayed in this screen.
- Simple display mode: 4 major measurement results are displayed in this screen.

Performance

- 6 selectable voltage ranges available from 15V to 300V with 0.1% of reading + 0.1% of range.
- 12 selectable current ranges available from 5mA to 20A with 0.1% of reading + 0.1% of range.
- It can even measure the voltage of abnormal wave of CF 3. The half-range CF is up to 6.

- It can even measure the current of abnormal wave of CF 3. The half-range CF is up to 6.
 - Test terminals in the front panel.
 - Total harmonic distortion measurement.
-

Features

- Full five-digit measurement.
 - Voltage measurement range: 15V ~ 600V or automatic switching
 - Current measurement range: 5mA ~ 20A or automatic switching
 - Maximum accuracy of 0.1% of reading + 0.1% of range
 - 2 main measurement readings and 6 minor measurement readings are displayed in the screen of standard display mode.
 - 4 main measurement readings are displayed in the screen of simple display mode.
 - Added stand-alone display of total harmonic distortion measurement function (13 steps)
 - Test bandwidth of voltage and current: DC ~ 6kHz.
 - Added W-h power time integrator function
 - Selectable boot settings (Previous / Default)
-

Interface

- Standard interface: USB / RS232 / LAN
-

Application

- It can be applied to production test such as power supplies, transformers, motors, electrical equipment and other equipment with low standby power.
- It can be applied to power measurement conforms to IEC 62301
- It can be applied to assess the power consumption of product design.

Accessories

Standard Accessories


Power Cords x 3

Test leads: 2x red, 2x black

Package Contents

Check the contents before using the instrument.

Opening the box

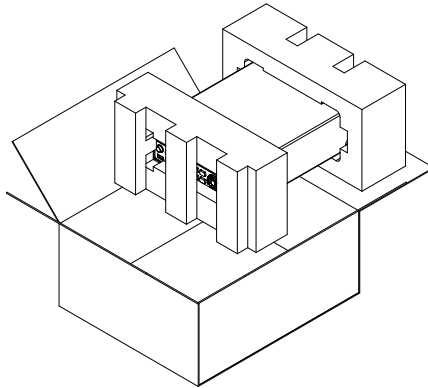


Contents
(single unit)

- Main unit
- Test leads (red x2, black x2)
- Power cords x 3
- Quick Start Guide



Appearance

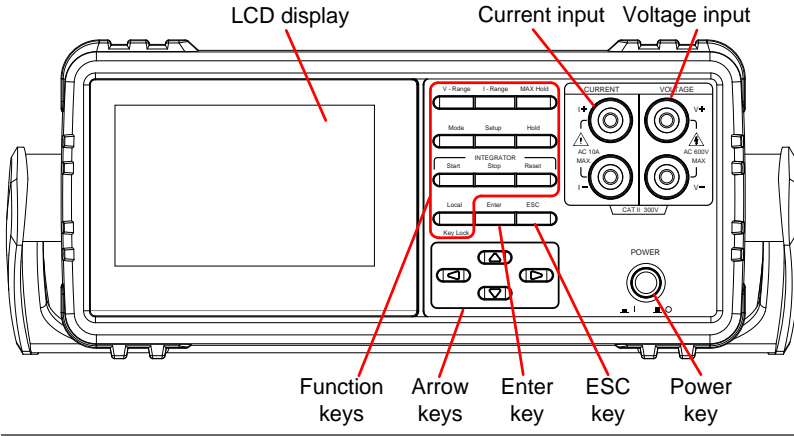
Front Panel




Power Switch

POWER

Turns On  or Off  the main power. For the power up sequence, see page 24.

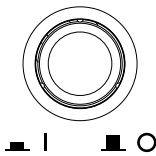

Current, Voltage Terminals

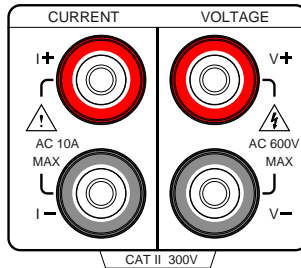

Current input: I+ and I- terminals; Voltage input: V+ and V- terminals.



Note

If the measurement power supply has positive and negative electrode, please connect + to the positive electrode of power supply and - to the negative electrode of power supply.

 


Warning


The maximum measurable current and voltage are 600 V and 10A for voltage and current terminals of the front panel of the T3PM1006. Do not input exceeded voltage and current, otherwise it will burn the device.

Function keys

V - Range



 
V-Range key, up/down arrow keys and Enter key can be used together to select a voltage range or auto range measurement mode. See page 27.




Enter



I - Range

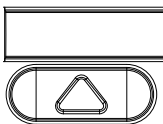

 
I-Range key, up/down arrow keys and Enter key can be used together to select a current range or auto range measurement mode. See page 27.




Enter




MAX Hold Press this button to display the maximum measurement reading. See page 50.




Mode Press this key to select measure mode (DC/ AC/ AC+DC). See page 51.





Setup Press this key to enter the measurement settings menu. See page 31.


 


Hold Press this key to switch window and stop refreshing. See page 51.





 Use the left and right arrow keys to select Integrator mode, and press Enter button to enter the time integrator function. See page 52.

Enter





Local Press this key to toggle to key lock. In Remote control mode, press this button to switch to local mode. See page 51.

 
Key Lock



Confirm button **Enter** This button is used to enter the menu, confirm the settings and switch between the standard display mode and simple display mode (no function table and display icon). See page 51.




Cancel (Exit)
button




Press this button to cancel the current setting. The cursor returns to the default position or return to the previous menu according to the situation. See page 51.

Arrow Keys

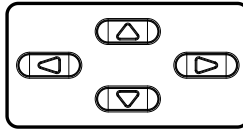

These four arrow keys are used to edit the parameters, browse the menu system and select the parameter range.

Display Overview

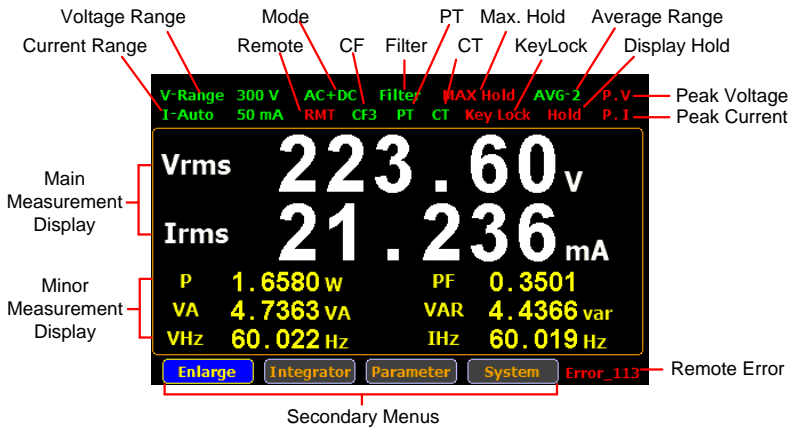


Item	Status icon	Description
Voltage Range	V_Range 300V	Voltage measurement range. Example here range is 300V. V_Auto means that Auto Range is turned on.
Current Range	I_Auto 50mA	Current measurement range. Example here range is 50mA. I_Auto means that Auto Range is turned on.
Mode	AC+DC	Measurement mode (AC, DC, AC+DC)
Remote	RMT	Remote control mode (on/off)
Crest Factor	CF3	Crest Factor (3/6)
Filter	Filter	Voltage and current filters (on/off)
PT Ratio State	PT	External voltage magnification (on/off)


CT Ratio State	CT	External current magnification (on/off)
Maximum Hold	Max. Hold	Retain and display the maximum measurement reading.
Keyboard Lock	KeyLock	Lock Key button
Average	Avg-1	Average number of sampling (1/2/4/8/16/32/64)
Display Hold	Hold	Retain and display the current measurement reading.
Peak Voltage	P.V	The voltage exceeds the measurement range
Peak Current	P.I	The current exceeds the measurement range
Remote Error	Err-XXX	An error occurs in remote command
Standard Display Mode	Display the measurement result of 2 major and 6 minor measurement parameters	
Simple Display Mode	Display the measurement result of 4 major measurement parameters	
Secondary menus	Display secondary function menu	
	• Enlarge	This function key is used to switch display of measurement result from 2 major plus 6 minor to 4 major ones.
	• Integrator	This function key is used to set up integrator measurement parameters and execute integrator measurement function.
	• Parameter	This function key is used to set up measurement parameters.

- System This function key is used to enter the system setting and system configuration screens.

Rear Panel

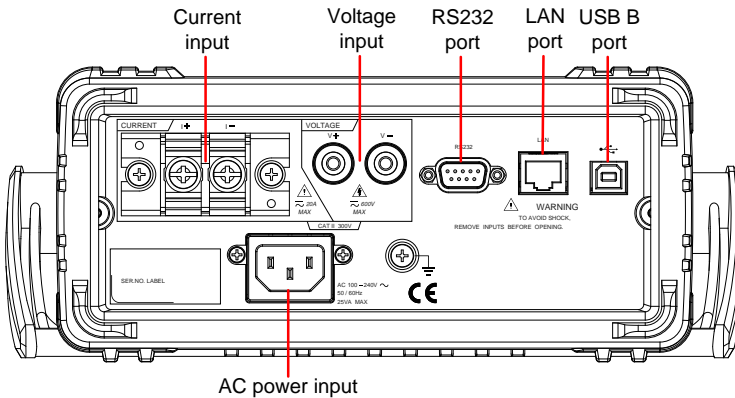


Power Cord Socket

 


Accepts the power cord.
AC 100~240V ±10%,
50/60Hz

 RS232




RS232 port. This port is used for remote control.

 USB Device Port




Type B USB port. This port is used for remote control.

LAN Port

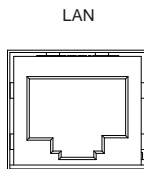

LAN Port.

Rear
Voltage/Current
input terminal

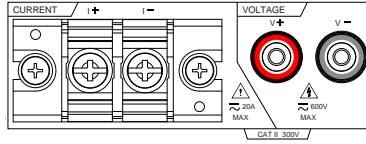

Rear
Voltage/Current
input terminal is
used to connect
the main
measurement
signals.




Warning

- Do not use damaged device. Before using the equipment, check its housing first to ensure there are no cracks. Do not operate this device in an environment containing explosive gases, steam or dust.
- The maximum measurable current and voltage are 600 V and 20A for voltage and current terminals of the rear panel of the T3PM1006. Do not input exceeded voltage and current, otherwise it will burn the device.
- Always use the supplied cable for connection.
- Before connecting the device, observe all the safety symbols marked on the device.
- Turn off the power to the device and the application system before connecting I/O terminals.
- Do not install replacement parts on the device or perform any unauthorized modifications.
- Do not use this device if the removable cover is removed or loosened.
- Do not connect any cables and terminals before performing self-test.
- Use only the power adapter supplied by the manufacturer to avoid accidental injury.
- Do not use this device for life support systems or any other equipment that has safety requirements.


Set Up

Tilting the Stand


From the base of the handle, gently pull the handle out sideways and then rotate it to one of the following positions.

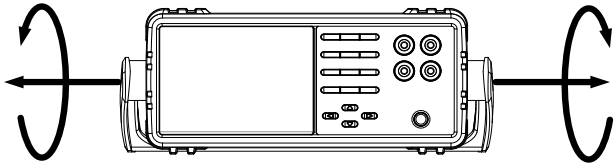


Horizontal
position

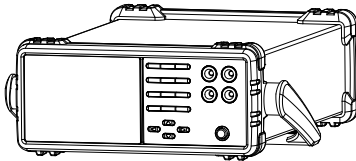

Tilt stand
position

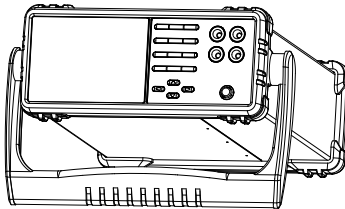


Carry position

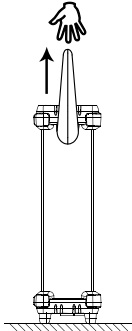

Power Up

Steps

1. Ensure the AC voltage is 100~ 240V.
2. Connect the power cord to the AC voltage input.

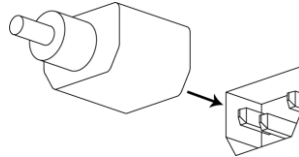

Note

Make sure the ground connector on the power cord is connected to a safety ground. This will influence the measurement accuracy.

3. Push to turn on the main power switch on the front panel.





4. The display turns on and shows the last function that was used before the power was reset.

Connect the wires to the T3PM1006

Background Two separate wires are used to connect the T3PM1006, so voltage and current measurement are isolated and don't interfere with each other.

Connection diagram

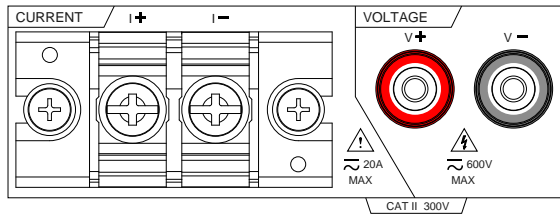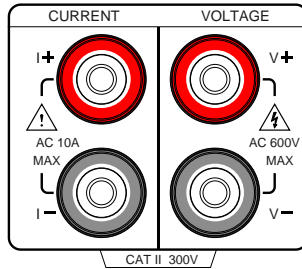

Note The terminals on the front and rear panels can't be used as input terminal at the same time.

- | | |
|--------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Description | <p>V + The positive voltage input (+)</p> <p>V - The negative voltage input (-)</p> <p>I + The positive current input (+), 10A for input on the front panel, 20A for input on the rear panel.</p> <p>I - The negative current input (-), 10A for input on the front panel, 20A for input on the rear panel.</p> <p>GND Provide reference grounding.</p> |
|--------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|


BASIC SETTING

Setting up measurement range	27
Auto Range.....	29
Setting up measurement status	31
Setting up synchronization source.....	31
Setting up filter	32
Setting up crest factor	33
Setting up auto-zero function.....	34
Setting up average value.....	35
Setting up method of calculating harmonics.....	36
Setting up the PT ratio status.....	37
Setting up the CT ratio status.....	38
Setting up the voltage and current skipping configuration...39	
Setting up System status	41
System configuration setting screen.....	41
Setting up power on status	41
Setting up brightness	42
Setting up key sound	43
Setting up interface.....	44



Setting up measurement range

To get accurate measurement results, set an appropriate measurement range before performing measurements.

 
Set voltage range 1. Press **V-Range** button.



 2. Use up and down arrow keys to select the desired range.

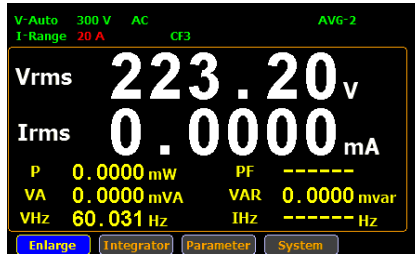

 
3. Press **Enter** button to confirm your selection.




Available range Crest Factor AUTO, 15V, 30V, 60V, 150V, 300V, 600V is 3:

Crest Factor AUTO, 7.5V, 15V, 30V, 75V, 150V, 300V is 6:

 Set current range 1. Press **I-Range** button.



2. Use up and down arrow keys to select the desired range.

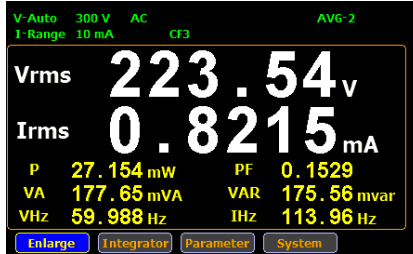

3. Press **Enter** button to confirm your selection.

Enter



Available range	Crest Factor is 3:	AUTO, 5mA, 10mA, 20mA, 50mA, 100mA, 200mA, 0.5A, 1A, 2A, 5A, 10A, 20A
	Crest Factor is 6:	AUTO, 2.5mA, 5mA, 10mA, 25mA, 50mA, 100mA, 250mA, 0.5A, 1A, 2.5A, 5A, 10A



Note

When the measurement range is set manually, if the range status icon lights in green, the measured value meets the setting range. On the contrary, if the range status icon lights in red, the measured value doesn't meet the best setting range. In this case, it is better to switch to another range to get more accurate measurement results.



Note

The P.I status icon lights in red when the current measurement circuit detects that the measured value exceeds setting range by 3 folds (CF is set to 3) or 6 folds (CF is set to 6).



The P.V status icon lights in red when the voltage measurement circuit detects that the measured value exceeds setting range by 3 folds (CF is set to 3) or 6 folds (CF is set to 6).

Auto Range

The range is automatically switched according to the voltage and current of input signal.


Range is shift up The range is shifted up when either of the following conditions is met.

- Vrms or Irms exceeds the current setting range by 110%.
- The Vpk or Ipk value of the input signal exceeds the current setting range by 330% at CF 3.
- The Vpk or Ipk value of the input signal exceeds the current setting range by 660% at CF 6.


Range is shift down The range is shifted down when all of the following conditions are met.

- Vrms or Irms is equal to or less than the 60% of previous range.
- The Vpk or Ipk value of the input signal is less than the next setting range by 300% at CF 3.
- The Vpk or Ipk value of the input signal is less than the next setting range by 600% at CF 6.

Example

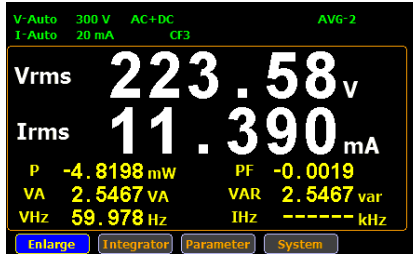



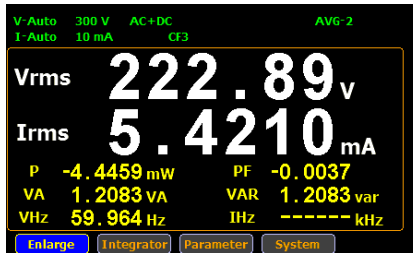




Irms exceeds the current setting range by 110%, so range is shifted to 20mA




Irms is less than or equal to 60% of the previous setting range, so range is shifted down to 10mA.

Setting up measurement status

Setting up synchronization source








Steps	1. Press Setup button.	Setup 
	2. Press Enter button.	Enter 
	3. Press down arrow key.	
	4. Press Enter button to enter Sync Source item. Use up and down arrow keys to select the desired option and then press Enter button again to confirm your selection.	Enter    Enter 




Option	<p>V: Select the voltage of signals as synchronization source.</p> <p>I: Select the current of signals as synchronization source.</p> <p>OFF: Select the entire interval of data updating period as synchronization source.</p>
--------	---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------

Default value V

Setting up filter



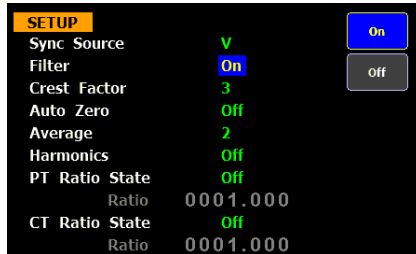




Steps	1. Press Setup button.	Setup 
	2. Press Enter button.	Enter 
	3. Press down arrow key twice.	 x2
	4. Press Enter button to enter Filter item. Use up and down arrow keys to select the desired option and then press Enter button again to confirm your selection.	Enter    Enter 




Option	On: Turn on the line filter function and Filter status icon on the display lights up in green.
	Off: Turn off the line filter function. Line filter cutoff frequency is 500Hz

Default value Off

Setting up crest factor



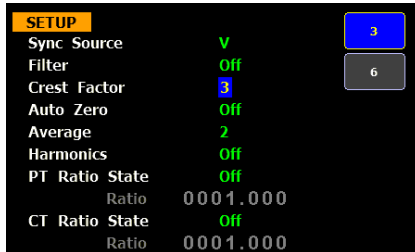




Steps	1. Press Setup button.	Setup 
	2. Press Enter button.	Enter 
	3. Press down arrow key three times.	 x3
	4. Press Enter button to enter Crest Factor item. Use up and down arrow keys to select the desired option and then press Enter button again to confirm your selection.	Enter    Enter 



Option	3:	Crest Factor is three.
	6:	Crest Factor is six.

Default value 3

Setting up auto-zero function








- | | | |
|-------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Steps | 1. Press Setup button. | Setup
 |
| | 2. Press Enter button. | Enter
 |
| | 3. Press down arrow key four times. |  x4 |
| | 4. Press Enter button to enter Auto Zero item. Use up and down arrow keys to select the desired option and then press Enter button again to confirm your selection. | Enter

 
Enter
 |



- | | |
|--------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Option | <p>On: Auto-zero function is activated once per hour or when range is switched</p> <p>Off: Auto-zero function is only activated once when the range is switched. The auto-zero function is turned off when the integrator function is executed</p> |
|--------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|

Default value Off

Setting up average value








- | | | |
|-------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Steps | 1. Press Setup button. | Setup
 |
| | 2. Press Enter button. | Enter
 |
| | 3. Press down arrow key five times. |  x5 |
| | 4. Press Enter button to enter Average item. Use up and down arrow keys to select the desired option and then press Enter button again to confirm your selection. | Enter

 
Enter
 |




Option 1, 2, 4, 6, 8, 16, 32 and 64:
 The measurement time is synchronized with the average value that you set. The larger the average value is, the longer the measurement time is. When the average value is set to 1, the measurement time is about 0.1 seconds. The larger the number is, the longer the measurement time is, and so forth.

Default value 2





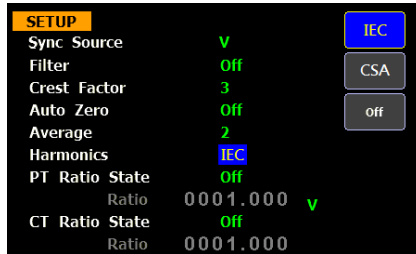


Setting up method of calculating harmonics


Steps	1. Press Setup button.	Setup 
	2. Press Enter button.	Enter 
	3. Press down arrow key six times.	 x6
	4. Press Enter button to enter Harmonics item. Use up and down arrow keys to select the desired option and then press Enter button again to confirm your selection.	Enter    Enter 



Option	IEC: Calculate the ratio of harmonic quantity of the 2nd through the 13th harmonic to the 1st harmonic.
	CSA: Calculate the ratio of harmonic quantity of the 2nd through the 13th harmonic to the 1st through the 13th harmonic.
	Off: Turn off the harmonic calculation function.
Default value	Off





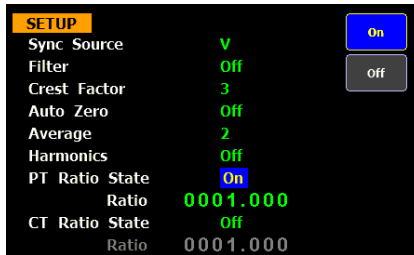


Setting up the PT ratio status

Steps	1. Press Setup button.	Setup 
	2. Press Enter button.	Enter 
	3. Press down arrow key seven times.	 x7
	4. Press Enter button to enter PT Ratio Status item. Use up and down arrow keys to select the desired option and then press Enter button again to confirm your selection.	Enter    Enter 



Option	On: Turn on the PT ratio calculation function and PT status icon on the display lights up in green. The setting range is from "1" to "9999.999".
	Off: Turn off the PT ratio calculation function.
Default option	Off



Setting up the CT ratio status





- | | | |
|-------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Steps | 1. Press Setup button. | Setup
 |
| | 2. Press Enter button. | Enter
 |
| | 3. Press down arrow key eight times. |  x8 |
| | 4. Press Enter button to enter CT Ratio Status item. Use up and down arrow keys to select the desired option and then press Enter button again to confirm your selection. | Enter

Enter
 
Enter
 |




- | | |
|----------------|--------------------------------------------------------------------------------------------------------------------------------------------------|
| Option | On: Turn on the CT ratio calculation function and CT status icon on the display lights up in green. The setting range is from "1" to "9999.999". |
| | Off: Turn off the CT ratio calculation function. |
| Default option | Off |





Setting up the voltage and current skipping configuration

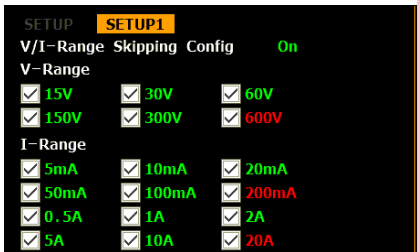- Steps
1. Press **Setup** button. 
 2. Press right arrow key to enter **SETUP1** tab. 



SETUP **SETUP1**
V/I-Range Skipping Config **Off**
V-Range
 15V 30V 60V
 150V 300V 600V
I-Range
 5mA 10mA 20mA
 50mA 100mA 200mA
 0.5A 1A 2A
 5A 10A 20A
 3. Press **Enter** button. 
 4. Press down arrow key to enter the **V/I-Range Skipping Config.** 
 5. Press **Enter** button. 
 6. Press up and down arrow keys to turn **On** the **V/I-Range Skipping Config.** 




7. Press **Enter** button to confirm setting. Enter

8. Press up, down, right and left arrow keys to move cursor to **V-Range** and **I-Range** fields where options are available for user to enable or disable for measurement.



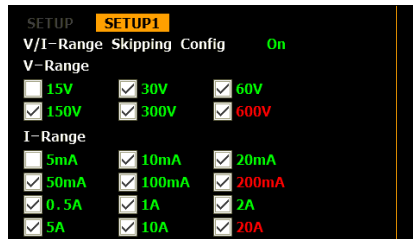

9. When, for example, disabling 15V option, move cursor to 15V followed by pressing **Enter** button and using up and down arrow keys to select **Off**. Press **Enter** key to confirm setting in the end.
 Enter









Enter

Option	<p>On When the option(s) is On, the selected range(s) will be applied to measurement.</p> <p>Off It is able is skip certain measurement range(s) that are not used by turning Off. By doing so, It can reduce measured data loss which happens while ranges are switched.</p>
--------	---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------

Default value	On
---------------	----


Setting up System status

System configuration setting screen

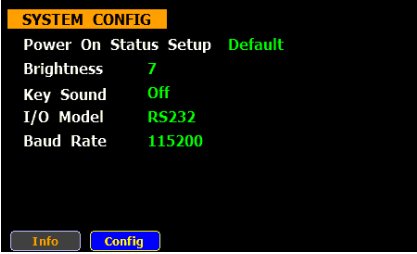
- | | | |
|-------|-------------------------------------------------------------------------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Steps | 1. Use left and right arrow keys on the front panel to select System function key. | 
 |
| | 2. Press Enter button to Enter SYSTEM INFORMATION setting screen. | <p style="text-align: center;">Enter</p>  |
| | 3. Press right arrow key to select Config key. |  |
| |  | |
| | 4. Press Enter button to enter SYSTEM CONFIG setting screen. | <p style="text-align: center;">Enter</p>  |

Setting up power on status

Background Continue the following setting from **SYSTEM CONFIG** setting screen

- | | | |
|-------|--------------------------|-------------------------------------------------------------------------------------|
| Steps | 1. Press down arrow key. |  |
|-------|--------------------------|-------------------------------------------------------------------------------------|

- Press **Enter** button to enter **Power On Status Setup** item. Use up and down keys to select the desired option and then press **Enter** button again to confirm your selection.

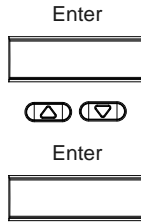

Option	<p>Previous: The status of device on powering on is set to the status before the last shutdown.</p> <p>Default: The status of device on powering on is set to the factory default status.</p>
Default value	Default

Setting up brightness

Background Continue the following setting from **SYSTEM CONFIG** setting screen


- | | | |
|-------|-------------------------------------------------------------------------------|----|
| Steps | <ol style="list-style-type: none"> Press down arrow key twice. | x2 |
|-------|-------------------------------------------------------------------------------|----|

- Press **Enter** button to enter **Brightness** item. Use up and down keys to select a number and then press **Enter** button again to confirm your selection.

Enter



Enter

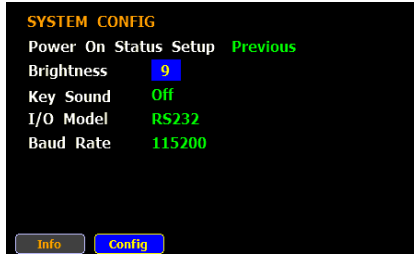


Option	1 to 9	The display is the darkest when set to 1. On the contrary, the brightest when set to 9.
--------	--------	-----------------------------------------------------------------------------------------



Default option	7
----------------	---

Setting up key sound

Background	Continue the following setting from SYSTEM CONFIG setting screen
------------	-------------------------------------------------------------------------

Steps	1. Press down arrow key three times.  x3
-------	-----------------------------------------------------------------------------------------------------------------------------

- Press **Enter** button to enter **Key Sound** item. Use up and down arrow keys to select the desired option and then press **Enter** button again to confirm your selection.

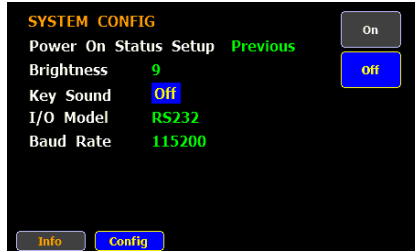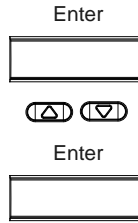


Option	On:	A short sound is heard from the speaker of device when pressing the keys on the front panel.
	Off:	No sound from the speaker of device when pressing the keys on the front panel.


Default option Off

Setting up interface

 Background Continue the following setting from **SYSTEM CONFIG** setting screen

- Steps 1. Press down arrow key four times. x4

2. Press **Enter** button to enter **I/O Model** item. Use up and down arrow keys to select the desired option and then press **Enter** button again to confirm your selection.

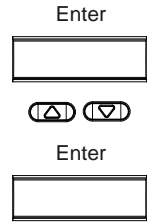

Option	<p>RS232: If interface is set to RS232, the Baud Rate can be selected from the following options.</p> <p>1200, 2400, 4800, 9600, 19200, 38400, 57600 or 115200</p> <p>For details about configuring RS 232 interface, please see page 60.</p> <p>USB: For details about configuring USB interface, please see page 60.</p> <p>GPIB: Disabled</p> <p>LAN: If interface is set to LAN, the IP model can be selected “Manual” or “DHCP”. Note that the socket port is fixed in “23” for the unit. For details about configuring LAN interface, please see page 61.</p>
--------	-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------

Default value RS232, 9600


MEASUREMENT AND OTHER FUNCTIONS

Measurement function	47
Introduction to measurement parameters	47
Setting measurement parameters	48
Other functions	50
Introduction to other functions	50
Integration measurement function	52
Setting up Integrator measurement	52
Introduction to integrator parameters	55
Using the integrator function	57

Measurement function

The T3PM1006 provides a wide range of basic electricity and power measurement functions. It is equipped with different accurate measurement parameters for accurately measuring the voltage, current, power, DC/AC/AC + DC, power factor, harmonics, frequency, etc. The input impedance of the device is $2.4\text{M}\Omega$, the maximum input voltage is 600V_{rms} . There are 2 sets of internal resistance (Shunt), $500\text{m}\Omega$ and $5\text{m}\Omega$ respectively. The maximum input current is 20A_{rms} . The device will issue a warning sound when the input voltage and current exceed 700V_{rms} or 25A_{rms} .

Introduction to measurement parameters

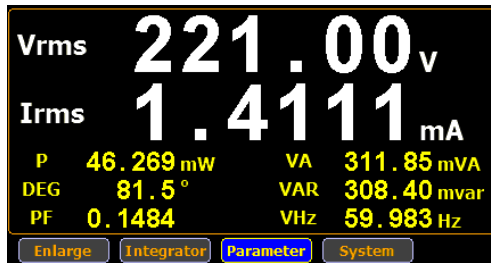

Parameter name	Display icon
Voltage	Vdc (DC voltage), Vrms (AC voltage)
Current	Idc (DC current), Irms (AC current)
Active Power	P
Apparent Power	VA
Reactive power	VAR
Power Factor	PF
Phase Angle	DEG
Frequency	IHz and VHz
Voltage Peak	V+pk and V-pk
Current Peak	I+pk and I-pk

Active Power Peak P+pk and P-pk

Total Harmonic Distortion THDI and THDV

 
Crest factor CFV, CFI

Setting measurement parameters

Please follow the steps blow to set the measurement parameters

Steps

1. Use left and right arrow keys on the front panel to select **Parameter** function key.



2. Press **Enter** button. A measurement parameter will be highlighted in green.

Enter




3. Press **Enter** button to confirm setting or use up and down arrow keys to select other desired measurement parameter.

Enter




Enter

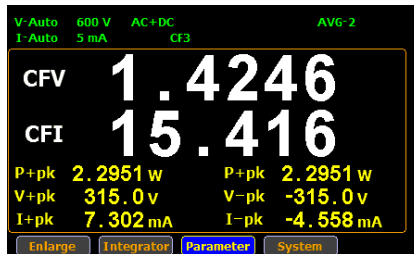

4. You can use same method as shown in the last step to set other measurement parameters in this screen.


- Switching display mode 5. In standard display mode, you simply press the **Enter** button to switch display mode to simple.

Enter

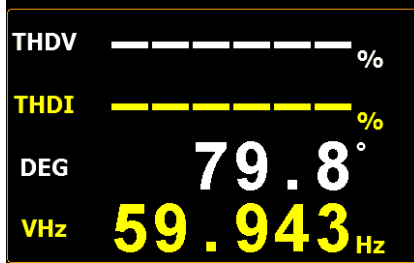


6. Press **ESC** button to return back to original display mode.


ESC

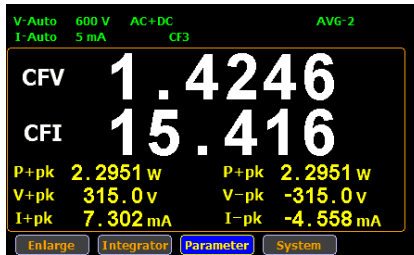

Other functions

Introduction to other functions

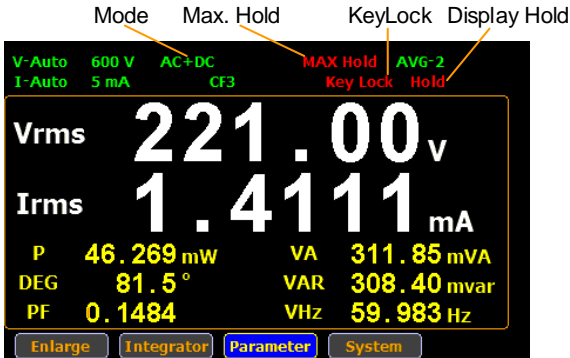

Function name	Button	Description
MAX Hold	<p>MAX Hold</p> 	<p>When the MAX Hold button is pressed, the MAX Hold status icon will light in red in the LCD display to indicate that this function is activated. To deactivate this function, press this button again.</p> <p>If the MAX Hold function is activated, the display value on the display is updated only when the current measured value is greater than the previous measured value. The maximum display value is retained on the display.</p>

Mode



Press this button to select measurement mode. There are 3 measurement modes.

- AC+DC: Displays all the components of the measurement signal
 - DC: Displays the DC part of the measurement signal.
 - AC: Displays the AC part of the measurement signal.
-


Hold



When the **Hold** button is pressed, the Hold status icon will light in red in the LCD display to indicate that this function is activated. To deactivate this function, press this button again.


When the Hold function is activated, the displayed value on the LCD display is not updated and the range is locked. Measurement is performed in the background.

Local/ KeyLock

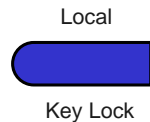

Dual function key. When Remote mode is activated, press this button to deactivate Remote mode and switch to Local mode. When Remote mode is not activated, this button is used as lock key of keypad.

 Enter



This button is used to select function or confirm selection.

ESC



 
This button is used to exit current screen or return to main measurement screen.

Integration measurement function


Setting up Integrator measurement

Steps

1. Use left and right arrow keys on the front panel to select **Integrator** function key.



 2. Press **Enter** button to enter the integrator measurement screen.




3. Press right arrow key to select **Set** key.



Select integrator measurement mode

- Press **Enter** button to enter integrator measurement setting screen.

Enter

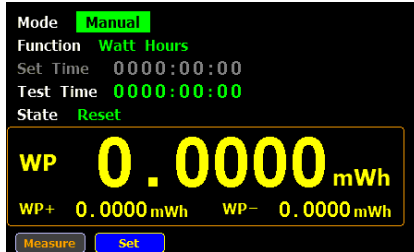


- Press **Enter** button to enter **Mode** item. Use up and down arrow keys to toggle between Manual and Standard mode. Press Enter button again to confirm your selection.

Enter




Enter

If you select Manual mode, the Set time is disabled and displayed in gray.

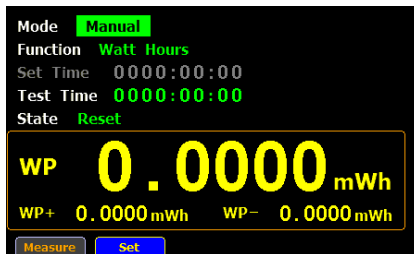

If you select standard mode, you need to set integrator measurement time before using integrator function. It can be set from 1 second to 9999 hours, 59 minutes and 59 seconds.

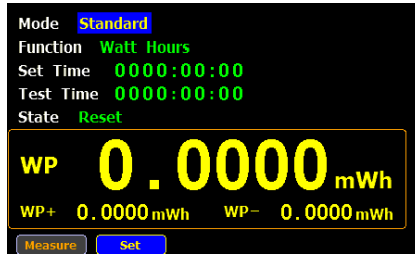

- Press down arrow key to select **Function** item in the integrator measurement setting screen.




Select integrator measurement function


- Press **Enter** button to enter **Function** item. Use up and down arrow keys to toggle between Ampere Hours and Watt Hours. Press Enter button again to confirm your selection.

Enter



Enter

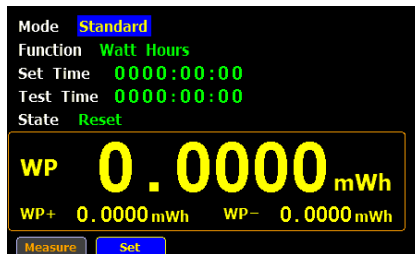

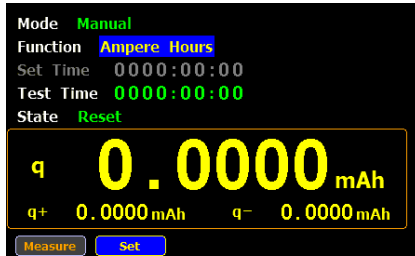


Introduction to integrator parameters

Parameter name	Description
Mode	<ul style="list-style-type: none"> Manual Standard
Function	<ul style="list-style-type: none"> Watt Hours WP: Total power WP+: Positive total power WP-: Negative total power Ampere Hours q: Total mAh q+: Positive total mAh q-: Negative total mAh
Set time	It indicates the time of integrator measurement to be set. It can be set from 1 second to 9999 hours, 59 minutes and 59 seconds.
Test time	It indicates that elapsed time of integrator measurement.



State



- **Running**
Integrator measurement is in progress.
- **Stop**
Integrator measurement has been stopped manually.
- **Timeout**
The time for running integrator measurement is up.
- **Reset**
The integrator measurement status is cleared.

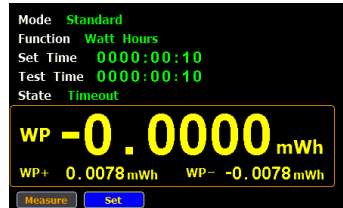


Using the integrator function

Manual mode

 
1. In manual mode, you can directly press the **Start** button in the front panel to start integrator function.

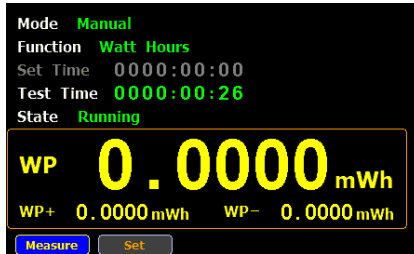

2. To stop integration function, press the **Stop** button in the front panel.

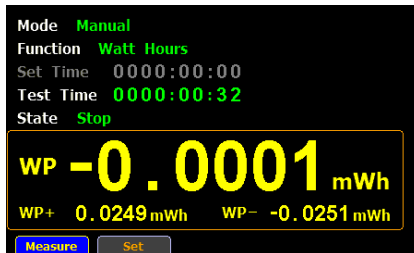


 3. Press the **Reset** button in the front panel to clear integrator.



- Standard mode
1. Set integrator measurement time before using integrator function.
 2. Other steps are the same as running in manual mode.

When integrator is running, the test time will increase until the setting integrator measurement time.

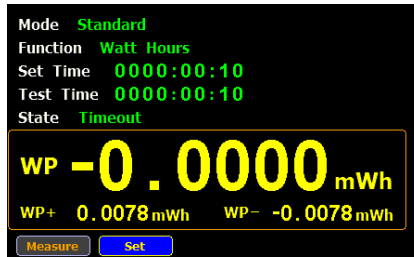

Note

- In the integration process, select the **Measure** key and press **Enter** button to return main measurement screen. Select **Integrator** key and press **Enter** button to switch back to integration measurement screen.
- In the integration process, you can't change measurement range and enter system to set measurement parameters.
- In the integration process, if the voltage or current measurement value is exceeded, the measured value will display in red.

REMOTE CONTROL

This chapter describes basic configuration of IEEE488.2 based remote control. For a command list, refer to the Command Overview chapter on page 64.

Configure Remote Control Interface	60
USB Interface	60
Configure USB Interface	60
Configure RS232 Interface	60
Configure LAN Interface	61
Return to Local Control	63

Configure Remote Control Interface

USB Interface

The USB device port on the rear panel is used for remote control. The USB port is configured as CDC interface.

When configured to CDC, the USB port on the T3PM1006 will appear as a virtual COM port to a connected PC. Any terminal program that can communicate via a serial port can be used for remote control. Before the T3PM1006 can be used for remote control using the CDC USB class, install the appropriate CDC USB driver available for download on the Teledyne LeCroy website.

Configure USB Interface


USB Configuration	PC connector	Type A, host
	T3PM1006 connector	Rear panel Type B, slave
	Speed	1.1/2.0 (full speed/high speed)
	USB Class	CDC (Communications device class)
	Hardware flow control	Off
	Data Bits	8
	Stop bit	1

Configure RS232 Interface


RS232 Configuration	Selectable Baud rate	1200, 2400,4800, 9600, 19200, 38400, 57600, 115200
	Parity	None
	Hardware flow control	Off
	Data Bits	8
	Stop bit	1

RS232 Pin Assignments

Pin 2: RxD
 Pin 3: TxD
 Pin 5: GND
 Pin 1, 4, 6 ~ 9: No Connection

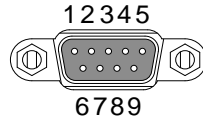

PC Connection Use a Null Modem connection as shown in the diagram below.

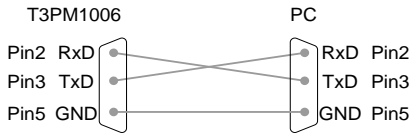


Configure LAN Interface

Background Continue the following setting from **SYSTEM CONFIG** setting screen

Steps

 1. Press down arrow key four times.



2. Press **Enter** button to enter **I/O Model** item. Use up and down arrow keys to select **LAN** option and then press **Enter** button again to confirm your selection.

Enter



Enter



3. Select a desired IP Model.



Option	Manual	Set up IP Address, Subnet mask and Gateway manually.
	DHCP	DHCP server automatically assigns IP Address, Subnet mask and Gateway.

Return to Local Control


Background When the unit is in remote control mode, the RMT icon above the main display can be seen. When this icon is not displayed, it indicates that the unit is in local control mode.

- Procedure**
1. Press the LOCAL key when in remote mode.
 2. The unit will go back into local mode and the RMT icon will turn off.

COMMAND OVERVIEW

The Command overview chapter lists all programming commands in functional order as well as alphabetical order. The command syntax section shows you the basic syntax rules you have to apply when using commands.

Command Syntax

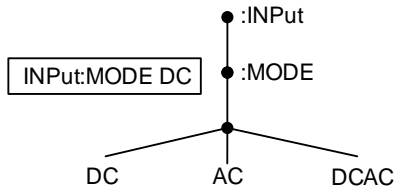Compatible Standard	IEEE488.2 SCPI, 1994	Partial compatibility Partial compatibility
Command Structure	<p>SCPI (Standard Commands for Programmable Instruments) commands follow a tree-like structure, organized into nodes. Each level of the command tree is a node. Each keyword in a SCPI command represents each node in the command tree. Each keyword (node) of a SCPI command is separated by a colon (:).</p> <p>For example, the diagram below shows an SCPI sub-structure and a command example.</p> <div style="text-align: center;">  <pre> graph TD A[INPut] --- B[MODE] B --- C[DC] B --- D[AC] B --- E[DCAC] </pre> </div>	

Command Types There are a number of different instrument commands and queries. A command sends instructions or data to the unit and a query receives data or status information from the unit.

Command types

Simple A single command with/without a parameter

Example :INPut:MODE DC

Query A query is a simple or compound command followed by a question mark (?). A parameter (data) is returned.

Example :INPut:CFACtor?

Command Forms Commands and queries have two different forms, long and short. The command syntax is written with the short form of the command in capitals and the remainder (long form) in lower case.

The commands can be written either in capitals or lower-case, just so long as the short or long forms are complete. An incomplete command will not be recognized.

Below are examples of correctly written commands.

Long form :INPut:SYNChronize VOLTage
:COMMunicate:HEADer ON


Short form :INP:SYNC VOLT
:COMM:HEAD ON

Square Brackets Commands that contain square brackets indicate that the contents are optional. The function of the command is the same with or without the square bracketed items, as shown below. For example, for the query:

`[:INPut]:FILTer?`

Both `:INPut:FILTer?` and `:FILTer?` are valid forms.

Command
Format

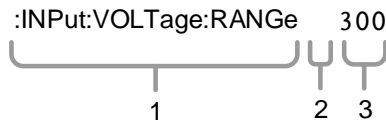

1. Command header
2. Space
3. Parameter 1

Common
Input Parameters

Type	Description	Example
<Boolean>	boolean logic	0, 1
<NR1>	integers	0, 1, 2, 3
<NR2>	decimal numbers	0.1, 3.14, 8.5
<NR3>	floating point with exponent	4.5e-1, 8.25e+1
<NRf>	any of NR1, 2, 3	1, 1.5, 4.5e-1
[MIN] (Optional parameter)	For commands, this will set the setting to the lowest value. This parameter can be used in place of any numerical parameter where indicated. For queries, it will return the lowest possible value allowed for the particular setting.	

[MAX] (Optional parameter)		For commands, this will set the setting to the highest value. This parameter can be used in place of any numerical parameter where indicated. For queries, it will return the highest possible value allowed for the particular setting.
Message Terminator (EOL)	Remote Command	Marks the end of a command line. The following messages are in accordance with IEEE488.2 standard. CR+LF
		The most common EOL character is CR+LF
Message Separator	EOL or ; (semicolon)	Command Separator

Command List

SCPI Commands	*CLS	70
	*IDN	70
	*ESE	70
	*ESR	71
	*OPC	71
	*RST	71
	*SRE	72
	*STB	72
COMMunicate	:COMMunicate:HEADer	73
Commands	:COMMunicate:REMote	73
	:COMMunicate:VERBose	74
DISPlay	:DISPlay[:NORMal]:ITEM<x>	75
Commands	:DISPlay:INTEgrate:ITEM<x>	76
	:DISPlay:PAGE	77
HARMonics	:HARMonics:THD	78
Command		
HOLD Command	:HOLD	79
INPut	[:INPut]:CFACtor	80
Commands	[:INPut]:MODE	80
	[:INPut]:VOLTage:RANGe	81
	[:INPut]:VOLTage:AUTO	81
	[:INPut]:VOLTage:CONFig	82
	[:INPut]:CURRent:RANGe	82
	[:INPut]:CURRent:AUTO	83
	[:INPut]:CURRent:CONFig	83
	[:INPut]:RCONfig	84
	[:INPut]:SCALing:{VT/PT CT}:STATe	84
	[:INPut]:SCALing:{VT/PT CT}:RATio	85
	[:INPut]:SYNChronize	85
	[:INPut]:FILTer	85

	[:INPut]:ZERO	86
INTegrate	:INTegrate:MODE.....	87
commands	:INTegrate:FUNCTion	87
	:INTegrate:TIMer	88
	:INTegrate:STARt.....	88
	:INTegrate:STOP.....	88
	:INTegrate:RESet	88
	:INTegrate:STATe	89
MEASure	:MEASure:AVERaging:COUNT	90
commands	:MEASure:MHOLd	90
NUMeric	:NUMeric[:NORMal]:VALue	91
commands	:NUMeric[:NORMal]:NUMBer	92
	:NUMeric[:NORMal]:ITEM<x>	92
	:NUMeric[:NORMal]:PRESet	94
	:NUMeric[:NORMal]:CLEar	96
	:NUMeric[:NORMal]:DELeTe.....	97
	:NUMeric[:NORMal]:HEADer	97
SYSTem	:SYSTem:MODEl.....	98
commands	:SYSTem:SERial	98
	:SYSTem:VERSion.....	98
	:SYSTem:KLOCK	99
	:SYSTem:BRIGhtness	99
	:SYSTem:KEY:BEEPer	100
STATus command	:STATus:ERRor.....	101

SCPI Commands

*CLS	70
*IDN	70
*ESE	70
*ESR	71
*OPC	71
*RST	71
*SRE	72
*STB	72

*CLS

Set →

Description	Clears the Event Status register (Output Queue, Operation Event Status, Standard Event Status).
Syntax	*CLS

*IDN

→ Query

Description	Returns the manufacturer, model number, serial number, and system version of the instrument.
Query Syntax	*IDN?
Return parameter	<String>
Example	*IDN? ->TELEDYNE,T3PM1006, GXXXXXXXXX,V1.00

Set →

→ Query

Description	Sets or returns the ESER (Event Status Enable Register) contents.
Syntax	*ESE <NR1>
Query Syntax	*ESE?

Parameter/	<NR1>	0~255
Return parameter		

Example *ESE 65
Set the ESER to 01000001
*ESE?
->130
ESER=10000010

*ESR → Query

Description Returns SESR (Standard Event Status Register).

Query Syntax *ESR?

Return parameter	<NR1>	0~255
------------------	-------	-------

Example *ESR?
->198
SESR=11000110

Set →

*OPC → Query

Description Sets or returns the operation complete bit (bit0) in SERS (Standard Event Status Register) when all pending operations are completed.

Syntax *OPC

Query Syntax *OPC?

Return parameter	<NR1>0	Operation isn't completed
	<NR1>1	Operation is completed

Example *OPC?
Returns 1.

 
Set →

*RST

Description Initializes the settings

Syntax *RST

*SRE



Description	Sets or returns SRER (Service Request Enable Register)	
Syntax	*SRE <NR1>	
Query Syntax	*SRE?	
Parameter/ Return parameter	<NR1>	0~255
Example	*SER 7 Set the the SRER to 00000111 *SRE? ->3 SRER=00000011	


*STB



Description	Returns the SBR (Status Byte Register) contents.	
Query Syntax	*STB?	
Return parameter	<NR1>	0~255
Example	*STB 8 ->81 SESR=01010001	

COMMunciate Commands

:COMMunicate:HEADer.....	73
:COMMunicate:REMote.....	73
:COMMunicate:VERBose.....	74

 :COMMunicate:HEADer  

Description	Sets or returns whether headers are attached to query responses	
Syntax	:COMMunicate:HEADer <Boolean> {OFF ON}	
Query Syntax	:COMMunicate:HEADer?	
Parameter	<Boolean>0	OFF
	<Boolean>1	ON
Return parameter	0	Turn the header function off
	1	Turn the header function on
Example	:COMMUNICATE:HEADER ON :COMMUNICATE:HEADER? ->:COMMUNICATE:HEADER 1	
Note	Example of a response with a header :INPUT:VOLTAGE:RANGE 150.0E+00 Example of a response without a header 150.0E+00	

:COMMunicate:REMote  

Description	Sets or returns the T3PM1006 to remote or local mode. ON is remote mode.	
Syntax	:COMMunicate:REMote <Boolean> {OFF ON}	
Query Syntax	:COMMunicate:REMote?	

Parameter	<Boolean>0	OFF
	<Boolean>1	ON
Return parameter	0	Turn the remote function off
	1	Turn the remote function on
Example	:COMMUNICATE:REMOTE ON :COMMUNICATE:REMOTE? ->:COMMUNICATE:REMOTE 1	

Set →

→ Query

:COMMunicate:VERBose

Description	Sets or returns whether the response to a query is returned fully spelled out or in its abbreviated form.	
Syntax	:COMMunicate:VERBose <Boolean>[{OFF ON}]	
Query Syntax	:COMMunicate:VERBose?	
Parameter	<Boolean>0	OFF
	<Boolean>1	ON
Return parameter	0	Turn the verbose function off
	1	Turn the verbose function on
Example	:COMMUNICATE:VERBOSE ON :COMMUNICATE:VERBOSE? ->:COMMUNICATE:VERBOSE 1	
Note	Example of a response fully spelled out :INPUT:VOLTAGE:RANGE 150.0E+00 Example of a response in abbreviated form :VOLT:RANG 150.0E+00	

DISPlay Commands

:DISPlay[:NORMal]:ITEM<x>	75
:DISPlay:INTEgrate:ITEM<x>	76
:DISPlay:PAGE	77

:DISPlay[:NORMal]:ITEM<x>

Set →

→ Query

Description Sets or returns a normal measurement data display item.

Syntax :DISPlay[:NORMal]:ITEM<x> <Function>

Query Syntax :DISPlay[:NORMal]:ITEM<x>?

Parameter/	<x>	1 to 8 (display)
Return parameter	<Function>	{U UPPeak UMPeak I IPPeak IMPeak P PPPeak PMPeak S Q LAMBda CFU CFI PHI FU FI UTHD ITHD}

Example

```
:DISPLAY:NORMAL:ITEM1 U
:DISPLAY:NORMAL:ITEM1?
->:DISPLAY:NORMAL:ITEM1 U
```

<Function>	Function	T3PM1006 Indicator
U	Voltage U	[V]
UPPeak	Maximum voltage: U+pk	[V+pk]
UMPeak	Minimum voltage: U-pk	[V-pk]
I	Current I	[I]
IPPeak	Maximum current: I+pk	[I+pk]
IMPeak	Minimum current: I-pk	[I-pk]
P	Active power P	[P]
PPPeak	Maximum power: P+pk	[P+pk]
PMPeak	Minimum power: P-pk	[P-pk]
S	Apparent power S	[VA]

Q	Reactive power Q	[VAR]
LAMBda	Power factor λ	[PF]
CFU	Voltage factor λ	[CFV]
CFV	Current factor λ	[CFI]
PHI	Phase difference Φ	[DEG]
FU	Voltage frequency fu	[VHz]
FI	Current frequency fl	[AHz]
UTHD	Total harmonic distortion of voltage Uthd	[THDV]
ITHD	Total harmonic distortion of current lthd	[THDI]

:DISPlay:INTEgrate:ITEM<x> Set →
→ Query

Description Sets or returns an Integrate measurement data display item.

Syntax :DISPlay:INTEgrate:ITEM<x> <Function>

Query Syntax :DISPlay:INTEgrate:ITEM<x>?


Parameter/ <x> 1 to 2(display)

Return parameter <Function> {WHP|WHM|AHP|AHM|U|I }.

Example :DISPLAY:INTEGRATE:ITEM1 WHP
:DISPLAY:INTEGRATE:ITEM1?
->:DISPLAY:INTEGRATE:ITEM1 WHP

<Function>	Function	T3PM1006 Indicator
WHP	Positive watt hour WP+	[WP+]
WHM	Positive watt hour WP-	[WP-]
AHP	Positive ampere hour q+	[q+]
AHM	Positive ampere hour q	[q-]
U	Voltage U	[V]
I	Current I	[I]

 
:DISPlay:PAGE



Description	Sets or returns the display page item.	
Syntax	:DISPlay:PAGE <Function>	
Query Syntax	:DISPlay:PAGE?	
Parameter/ Return parameter	<Function>	{MEASurement ENLArge INTEgral SYSTem_INFO SYSTem_CONFig SETUp}
Example	:DISPLAY:PAGE MEASUREMENT :DISPLAY:PAGE? ->:DISPLAY:PAGE MEASUREMENT	

HARMonics Command

 :HARMonics:THD



Description Sets or returns the equation used to compute the THD (total harmonic distortion).

Syntax :HARMonics:THD {TOTal|FUNDamental}

Query Syntax :HARMonics:THD?

Parameter/ TOTal (CSA)

Return parameter FUNDamental (IEC)

Example :HARMONICS:THD FUNDAMENTAL

 :HARMONICS:THD?

 ->:HARMONICS:THD FUNDAMENTAL

HOLD Command

:HOLD



Description Sets or returns the on/off state of the output hold feature for display, communication, and other types of data.

Syntax :HOLD <Boolean>[{OFF|ON}]

Query Syntax :HOLD?

Parameter	<Boolean>0	OFF
	<Boolean>1	ON

Return parameter	0	Turn the hold function off
	1	Turn the hold function on

Example :HOLD OFF
 :HOLD?
 ->:HOLD 0

INPut Commands

[:INPut]:CFACtor.....	80
[:INPut]:MODE	80
[:INPut]:VOLTage:RANGe	81
[:INPut]:VOLTage:AUTO	81
[:INPut]:VOLTage:CONFig	82
[:INPut]:CURRent:RANGe	82
[:INPut]:CURRent:AUTO	83
[:INPut]:CURRent:CONFig	83
[:INPut]:RCONfig.....	84
[:INPut]:SCALing:{VT/PT CT}:STATe.....	84
[:INPut]:SCALing:{VT/PT CT}:RATio.....	85
[:INPut]:SYNChronize.....	85
[:INPut]:FILTer	85
[:INPut]:ZERO.....	86

[:INPut]:CFACtor



Description	Sets or returns the crest factor.	
Syntax	[:INPut]:CFACtor {<NRF>}	
Query Syntax	[:INPut]:CFACtor?	
Parameter/ Return parameter	<NR1>	3, 6
Example	:INPUT:CFACtor 3 :INPUT:CFACtor? ->:INPUT:CFACtor 3	

[:INPut]:MODE



Description	Sets or returns the voltage and current measurement mode.	
Syntax	[:INPut]:MODE {DC ACDC AC}	
Query Syntax	[:INPut]:MODE?	

Parameter/	Select the dc measurement mode.
Return parameter	Select the acdc measurement mode. Select the ac mode.
Example	:INPUT:MODE DC :INPUT:MODE? ->:INPUT:MODE DC

Set →
 → Query

[:INPut]:VOLTage:RANGe


 
Description	Sets or returns the voltage range.				
Syntax	[:INPut]:VOLTage:RANGe {<Voltage>}				
Query Syntax	[:INPut]:VOLTage:RANGe?				
Parameter/ Return parameter	<table border="0"> <tr> <td style="background-color: #e0e0e0;"><Voltage></td> <td>15, 30, 60, 150, 300, 600(V) when the crest factor is set to 3.</td> </tr> <tr> <td style="background-color: #e0e0e0;"></td> <td>7.5, 15, 30, 75, 150, 300(V) when the crest factor is set to 6</td> </tr> </table>	<Voltage>	15, 30, 60, 150, 300, 600(V) when the crest factor is set to 3.		7.5, 15, 30, 75, 150, 300(V) when the crest factor is set to 6
<Voltage>	15, 30, 60, 150, 300, 600(V) when the crest factor is set to 3.				
	7.5, 15, 30, 75, 150, 300(V) when the crest factor is set to 6				
Example	:INPUT:VOLTAGE:RANGE 600V :INPUT:VOLTAGE:RANGE? ->:INPUT:VOLTAGE:RANGE 600.0E+00				

Set →
 → Query

[:INPut]:VOLTage:AUTO

Description	Sets or returns the voltage auto range on/off state.				
Syntax	[:INPut]:VOLTage:AUTO {<Boolean>}				
Query Syntax	[:INPut]:VOLTage:AUTO?				
Parameter	<table border="0"> <tr> <td style="background-color: #e0e0e0;"><Boolean>0</td> <td>OFF</td> </tr> <tr> <td style="background-color: #e0e0e0;"><Boolean>1</td> <td>ON</td> </tr> </table>	<Boolean>0	OFF	<Boolean>1	ON
<Boolean>0	OFF				
<Boolean>1	ON				
Return parameter	<table border="0"> <tr> <td style="background-color: #e0e0e0;">0</td> <td>Turn the voltage auto range function off.</td> </tr> <tr> <td style="background-color: #e0e0e0;">1</td> <td>Turn the voltage auto range function on.</td> </tr> </table>	0	Turn the voltage auto range function off.	1	Turn the voltage auto range function on.
0	Turn the voltage auto range function off.				
1	Turn the voltage auto range function on.				

Example :INPUT:VOLTAGE:AUTO ON
 :INPUT:VOLTAGE:AUTO?
 ->:INPUT:VOLTAGE:AUTO 1

 →
 ← 


[:INPut]:VOLTage:CONFig


Description	Sets or returns the valid voltage range.	
Syntax	[:INPut]:VOLTage:CONFig {ALL <Voltage>[,Voltage]...}	
Query Syntax	[:INPut]:VOLTage:CONFig?	
Parameter/ Return parameter	ALL	All ranges are valid.
	<Voltage>	See(:INPut:VOLTage:RANGe).
Example	:INPUT:VOLTAGE:CONFIG 300,150,30 :INPUT:VOLTAGE:CONFIG? ->:INPUT:VOLTAGE:CONFIG 300.0E+00,150.0E+00, 30.0E+00	

 →
 ← 

[:INPut]:CURRent:RANGe


Description	Sets or returns the current range.	
Query	[:INPut]:CURRent:RANGe {<Current>}	
Query Syntax	[:INPut]:CURRent:RANGe?	
Parameter/ Return parameter	<Current>	5, 10, 20, 50, 100, 200, 500(mA) 1, 2, 5, 10, 20(A) when the crest factor is set to 3.
		2.5, 5, 10, 25, 50, 100, 250(mA) 0.5, 1, 2.5, 5, 10(A)when the crest factor is set to 6
Example	:INPUT:CURRENT:RANGE 20A :INPUT:CURRENT:RANGE? ->:INPUT:CURRENT:RANGE 20.0E+00	






[:INPut]:CURRent:AUTO


Description	Sets or returns the current auto range on/off state.	
Syntax	[:INPut]:CURRent:AUTO {<Boolean>}	
Query Syntax	[:INPut]:CURRent:AUTO?	
Parameter	<Boolean>0	OFF
	<Boolean>1	ON
Return parameter	0	Turn the current auto range function off.
	1	Turn the current auto range function on.
Example	:INPUT:CURRENT:AUTO ON :INPUT:CURRENT:AUTO? ->:INPUT:CURRENT:AUTO 1	



 



[:INPut]:CURRent:CONFig


Description	Sets or returns the valid current range.	
Syntax	[:INPut]:CURRent:CONFig {ALL <Current>[,Current]...}	
Query Syntax	[:INPut]:CURRent:CONFig?	
Parameter/ Return parameter	ALL	All ranges are valid.
	<Current>	See(:INPut:CURRent:RANGe).
Example	:INPUT:CURRENT:CONFIG 20,10,1 :INPUT:CURRENT:CONFIG? ->:INPUT:CURRENT:CONFIG 20.0E+00,10.0E+00, 1.0E+00	




 


[:INPut]:RCONfig	
Description	Sets or returns the on/off state of the range configuration (valid range selection) feature.
Syntax	[:INPut]:RCONfig {<Boolean> OFF ON}
Query Syntax	[:INPut]:RCONfig?
Parameter	<div style="background-color: #e0e0e0; padding: 2px;"><Boolean>0 OFF</div> <div style="padding: 2px;"><Boolean>1 ON</div>
Return parameter	<div style="background-color: #e0e0e0; padding: 2px;">0 Turn the range configuration feature off.</div> <div style="padding: 2px;">1 Turn the range configuration feature on.</div>
Example	:INPUT:RCONFIG ON :INPUT:RCONFIG? ->:INPUT:RCONFIG 1




 


[:INPut]:SCALing:{VT/PT CT}::STATe	
Description	Sets or returns the scaling vt/pt,ct on/off state.
Syntax	[:INPut]:SCALing:{VT/PT CT}::STATe {<Boolean>}
Query Syntax	[:INPut]:SCALing:{VT/PT CT}::STATe?
Parameter	<div style="background-color: #e0e0e0; padding: 2px;"><Boolean>0 OFF</div> <div style="padding: 2px;"><Boolean>1 ON</div>
Return parameter	<div style="background-color: #e0e0e0; padding: 2px;">0 Turn the scaling vt/pt, ct function off.</div> <div style="padding: 2px;">1 Turn the scaling vt/pt, ct function on.</div>
Example	:INPUT:SCALING:VT:STATE ON :INPUT:SCALING:VT:STATE? ->:INPUT:SCALING:VT:STATE 1


 
[:INPut]:SCALing:{VT/PT|CT}:RATio

Description	Collectively Sets or returns the vt/pt ratio or ct ratio.
Syntax	[:INPut]:SCALing:{VT/PT CT}:RATio {<NRf>}
Query Syntax	[:INPut]:SCALing:{VT/PT CT}: RATio?
Parameter/ Return parameter	<NRf> 1.000 to 9999.999
Example	:INPUT:SCALING:VT:RATIO 1 :INPUT:SCALING:VT:RATIO? ->:INPUT:SCALING:VT:RATIO 1

[:INPut]:SYNChronize


Description	Sets or returns the synchronization source.
Syntax	[:INPut]:SYNChronize {VOLTage CURRent OFF}
Query Syntax	[:INPut]:SYNChronize?
Parameter/ Return parameter	Select the voltage synchronization source. Select the current synchronization source. Select the off synchronization source.
Example	:INPUT:SYNCHRONIZE VOLTAGE :INPUT:SYNCHRONIZE? ->:INPUT:SYNCHRONIZE VOLTAGE

[:INPut]:FILTer

Description	Sets or returns the filter state.
Syntax	[:INPut]:FILTer {<Boolean>}
Query Syntax	[:INPut]:FILTer?

Parameter	<Boolean>0	OFF
	<Boolean>1	ON
Return parameter	0	Turn the filter function off.
	1	Turn the filter function on.
Example	:INPUT:FILTER OFF :INPUT:FILTER? ->:INPUT:FILTER 0	

 


[:INPut]:ZERO

Description	Sets or returns the zero state.	
Syntax	[:INPut]:ZERO {<Boolean>}	
Query Syntax	[:INPut]:ZERO?	
Parameter	<Boolean>0	OFF
	<Boolean>1	ON
Return parameter	0	Turn the zero function off.
	1	Turn the zero function on.
Example	:INPUT:ZERO OFF :INPUT:ZERO? ->:INPUT:ZERO 0	

INTEgrate Commands


:INTEgrate:MODE.....	87
:INTEgrate:FUNcTION	87
:INTEgrate:TIMer	88
:INTEgrate:STARt.....	88
:INTEgrate:STOP.....	88
:INTEgrate:RESet	88
:INTEgrate:STATe	89

 :INTEgrate:MODE






Description	Sets or returns the integration mode.	
Syntax	:INTEgrate:MODE {MANUAl STANdard}	
Query Syntax	:INTEgrate:MODE?	
Parameter/ Return parameter	MANUAl	Continuous integration mode.
	STANdard	Standard integration mode.
Example	:INTEGRATE:MODE MANUAL :INTEGRATE:MODE? ->:INTEGRATE:MODE MANUAL	

 
:INTEgrate:FUNcTION




Description	Sets or returns the integration function.	
Syntax	:INTEgrate:FUNcTION {WATT AMPERe}	
Query Syntax	:INTEgrate: FUNcTION?	
Parameter/ Return parameter	Select the integration function watt.	
	Select the integration function ampere.	
Example	:INTEGRATE:FUNCTION WATT :INTEGRATE:FUNCTION? ->:INTEGRATE:FUNCTION WATT	

									
:INTEgrate:TiMER									
Description	Sets or returns the integration timer value.								
Syntax	:INTEGrate:TiMER {<NRf>,<NRf>,<NRf>}								
Query Syntax	:INTEGrate:TiMER?								
Parameter/ Return parameter	<table style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 30%; border-right: 1px solid black;">{<NRf>,<NRf>,<NRf>}</td> <td>0,0,0 to 9999,59,59</td> </tr> <tr> <td style="border-right: 1px solid black;">First <NRf></td> <td>0 to 9999 (hours)</td> </tr> <tr> <td style="border-right: 1px solid black;">Second <NRf></td> <td>0 to 59 (minutes)</td> </tr> <tr> <td style="border-right: 1px solid black;">Third <NRf></td> <td>0 to 59 (seconds)</td> </tr> </table>	{<NRf>,<NRf>,<NRf>}	0,0,0 to 9999,59,59	First <NRf>	0 to 9999 (hours)	Second <NRf>	0 to 59 (minutes)	Third <NRf>	0 to 59 (seconds)
{<NRf>,<NRf>,<NRf>}	0,0,0 to 9999,59,59								
First <NRf>	0 to 9999 (hours)								
Second <NRf>	0 to 59 (minutes)								
Third <NRf>	0 to 59 (seconds)								
Example	<pre>:INTEGRATE:TIMER 1,0,0 :INTEGRATE:TIMER? ->:INTEGRATE:TIMER 1,0,0</pre>								

	
:INTEgrate:STARt	
Description	Starts integration.
Syntax	:INTEgrate:STARt
Example	:INTEGRATE:START

	
:INTEgrate:STOP	
Description	Stops integration.
Syntax	:INTEgrate:STOP
Example	:INTEGRATE:STOP

	
:INTEgrate:RESet	
Description	Resets the integrated value.
Syntax	:INTEgrate:RESet
Example	:INTEGRATE:RESET

:INTegrate:STATe


→ Query

Description	Queries the integration status.	
Syntax	:INTegrate:STATe?	
Example	:INTEGRATE:STATE? ->RESET	
Response	Overflow	Integration overflows.
	RESET	Integration resets.
	RUNNING	Integration is in progress.
	STOP	Integration stops.
	TIMEUP	Integration stops due to integration timeout.

MEASure Commands


:MEASure:AVERaging:COUNT	90
:MEASure:MHOLD	90

 :MEASure:AVERaging:COUNT



Description	Sets or returns the averaging coefficient.	
Syntax	:MEASure:AVERaging:COUNT {<NRf>}	
Query Syntax	:MEASure:AVERaging:COUNT?	
Parameter/ Return parameter	<NRf>	1, 2, 4, 8, 16, 32, 64
Example	:MEASURE:AVERAGING:COUNT 8 :MEASURE:AVERAGING:COUNT? ->:MEASURE:AVERAGING:COUNT 8	

 :MEASure:MHOLD



Description	Sets the MAX hold on/off state.	
Syntax	:MEASure:MHOLD {<Boolean>}	
Query Syntax	MEASure:MHOLD?	
Parameter	<Boolean>0	OFF
	<Boolean>1	ON
Return parameter	0	Turn the MAX hold function off.
	1	Turn the MAX hold function on.
Example	:MEASURE:MHOLD ON :MEASURE:MHOLD? ->:MEASURE:MHOLD 1	

NUMERIC Commands

:NUMERIC[:NORMAL]:VALUE	91
:NUMERIC[:NORMAL]:NUMBER	92
:NUMERIC[:NORMAL]:ITEM<x>	92
:NUMERIC[:NORMAL]:PRESET	94
:NUMERIC[:NORMAL]:CLEAR	96
:NUMERIC[:NORMAL]:DELETE	97
:NUMERIC[:NORMAL]:HEADER	97

:NUMERIC[:NORMAL]:VALUE → Query

Description	Returns the numeric data.
Syntax	:NUMERIC[:NORMAL]:VALUE?
Example	:NUMERIC:NORMAL:VALUE? -> 103.79E+00,1.0143E+00,105.27E+00,..(omitted)...,50.0 01E+00
Numeric Data Format	<ul style="list-style-type: none"> • Measurement values U, I, P, PPPeak, PMPeak, S, Q, LAMBda, CFU, CFI, FU, FI, UTHD and ITHD • Integrated values WH, WHP, WHM, AH, AHP and AHM. ASCII: <NR3> format. Example: [-]12.345E+00 • Measurement values UPPeak, UMPeak, IPPeak and IMPeak. ASCII: <NR3> format. Example: [-]12.34E+00 • Measurement values (PHI) ASCII: <NR3> = 0~9.9 format. Example: [-]9.9E+00 ASCII: <NR3> = 10~99.9 format. Example: [-]99.9E+00 ASCII: <NR3> = 100~999.9 format. Example: [-]999.9E+000

- Elapsed integration time (TIME)
ASCII: <NR1> format in units of seconds.
Example: 3600 for 1 hour (1:00:00).

- No items (“-----”)
ASCII: NAN (Not A Number)

- Error Data
- Data does not exist (the display shows “-----”)
ASCII: NAN (Not A Number)

:NUMeric[:NORMal]:NUMBER (Set) →
← (Query)

Description Sets or returns the specified numeric data output item function.

Syntax :NUMeric[:NORMal]:ITEM<x> {<Function>}ALL}

Query Syntax :NUMeric[:NORMal]:NUMBER?

Parameter/
Return parameter <NRf> 1 to 34(ALL)

Example :NUMERIC:NORMAL:NUMBER 10
:NUMERIC:NORMAL:NUMBER
->:NUMERIC:NORMAL:NUMBER 10

- Note
- If the parameter is omitted from the :NUMeric[:NORMal]:VALue? command, the numeric data items from 1 to the specified value are output in order.
 - By default, the number of numeric data items is set to 3.

:NUMeric[:NORMal]:ITEM<x> (Set) →
← (Query)

Description Sets or returns the specified numeric data output item function.

Syntax :NUMeric[:NORMal]:ITEM<x> {<Function>}

Query Syntax :NUMeric[:NORMal]:ITEM<x>?

Parameter/ Return parameter	<x> <Function>	1 to 34 (item number) {U UPPeak UMPeak I IPPeak IMPeak P PPPeak PMPeak S Q LAMBda CFU CFI PHI FU FI UTHD ITHD WH WHP WHM AH AHP AHM TIME URANge IRANge}
--------------------------------	-------------------	----------------------------------------------------------------------------------------------------------------------------------------------------------------------------

Example :NUMERIC:NORMAL:ITEM1 U
:NUMERIC:NORMAL:ITEM1?
->:NUMERIC:NORMAL:ITEM1 U

<Function>	Function	T3PM1006 Indicator
U	Voltage U	[V]
UPPeak	Maximum voltage: U+pk	[V+pk]
UMPeak	Minimum voltage: U-pk	[V-pk]
I	Current I	[I]
IPPeak	Maximum current: I+pk	[I+pk]
IMPeak	Minimum current: I-pk	[I-pk]
P	Active power P	[P]
PPPeak	Maximum power: P+pk	[P+pk]
PMPeak	Minimum power: P-pk	[P-pk]
S	Apparent power S	[VA]
Q	Reactive power Q	[VAR]
LAMBda	Power factor λ	[PF]
CFU	Voltage factor λ	[CFV]
CFV	Current factor λ	[CFI]
PHI	Phase difference Φ	[DEG]
FU	Voltage frequency fu	[VHz]
FI	Current frequency fl	[AHz]
UTHD	Total harmonic distortion of voltage Uthd	[THDV]

ITHD	Total harmonic distortion of current Ithd	[THDI]
WH	Watt hour WP	[WP]
WHP	Positive watt hour WP+	[WP+]
WHM	Positive watt hour WP-	[WP-]
AH	Ampere hour q	[q]
AHP	Positive ampere hour q+	[q+]
AHM	Positive ampere hour q-	[q-]
TIME	Integration time	
URANge	Voltage range	
IRANge	Current range	

:NUMeric[:NORMal]:PRESet



Description Presets the numeric data output item pattern.

Syntax :NUMeric[:NORMal]:PRESet {<Nrf>}

Parameter/ Return parameter	<Nrf>	1 to 4
--------------------------------	-------	--------

Example :NUMERIC:NORMAL:PRESET 1

Patterns 1	ITEM<x>	<Function>
	1	U
	2	I
	3	P

Patterns 2	ITEM<x>	<Function>
	1	U
	2	I
	3	P
	4	S
	5	Q
	6	LAMBda

	7	PHI
	8	FU
	9	FI
Patterns 3	ITEM<x>	<Function>
	1	U
	2	I
	3	P
	4	S
	5	Q
	6	LAMBda
	7	PHI
	8	FU
	9	FI
	10	UPPeak
	11	UMPeak
	12	IPPeak
	13	IMPeak
	14	PPPeak
	15	PMPeak
Patterns 4	ITEM<x>	<Function>
	1	U
	2	I
	3	P
	4	S
	5	Q
	6	LAMBda
	7	PHI
	8	FU
	9	FI

10	UPPeak
11	UMPeak
12	IPPeak
13	IMPeak
14	TIME
15	WH
16	WHP
17	WHM
18	AH
19	AHP
20	AHM
21	PPPeaK
22	PMPeaK
23	CFU
24	CFI
25	UTHD
26	ITHD
27	URANge
28	IRANge

:NUMeric[:NORMal]:CLEar



Description Clears numeric data output items (sets the items to "-----").

Syntax :NUMeric[:NORMal]:CLEar {ALL|<NRf>[,<NRf>]}

Parameter	First <NRf>	1 to 34 (the number of the first item to clear)
	Second <NRf>	1 to 34 (the number of the last item to clear)

Example :NUMERIC:NORMAL:CLEAR ALL

Note If the 2nd <Nrf> is omitted, the output item specified by the first and all following output items (up to number 34) are cleared.

:NUMeric[:NORMal]:DElete (Set) →

Description	Deletes numeric data output items.	
Syntax	:NUMeric[:NORMal]:DElete {ALL <Nrf>[,<Nrf>]}	
Parameter	First <Nrf>	1 to 34 (the number of the first item to delete)
	Second <Nrf>	1 to 34 (the number of the last item to delete)
Example	:NUMERIC:NORMAL:DELETE 1 (Deletes ITEM1 and shifts ITEM2 and subsequent items forward). :NUMERIC:NORMAL:DELETE 1,3 (Deletes ITEM1 to ITEM3 and shifts ITEM4 and subsequent items forward).:INTEGRATE:RESET	
Note	<ul style="list-style-type: none"> When output items are deleted, subsequent items shift forward to fill the empty positions. Empty positions at the end are set to "-----". If the second <Nrf> is omitted, only the output item specified by the first number is deleted. 	

:NUMeric[:NORMal]:HEADer → (Query)

Description	Returns the numeric data header.
Syntax	:NUMeric[:NORMal]:HEADer?
Example	<p>The data names of the items from 1 to the number specified by the :</p> <p>NUMeric[:NORMal]:NUMBer command are output in order.</p> <p>:NUMERIC:NORMAL:NUMBER 3</p> <p>:NUMERIC:NORMAL:HEADER?</p> <p>-> Urms,Irms,P</p>

SYSTem Commands

:SYSTem:MODEl.....	98
:SYSTem:SERial	98
:SYSTem:VERsion.....	98
:SYSTem:KLOCK	99
:SYSTem:BRIGhtness	99
:SYSTem:KEY:BEEPer	100

:SYSTem:MODEl → Query

Description	Returns the model code.
Syntax	:SYSTem:MODEl?
Example	:SYSTEM:MODEL? ->:SYSTEM:MODEL "T3PM1006"

:SYSTem:SERial → Query

Description	Returns the serial number.
Syntax	:SYSTem:SERial?
Example	:SYSTEM:SERIAL? ->:SYSTEM:SERIAL "123456789A"
Note	Returns the No. item string of the system Information menu.

:SYSTem:VERsion → Query

Description	Returns the firmware version.
Syntax	:SYSTem:VERsion?
Example	:SYSTEM:VERSION? ->"V1.00"

Note Returns the Ver. item string of the system Information menu.

:SYSTem:KLOCK

Set →

→ Query

Description Sets or returns the on/off state of the key protection.

Syntax :SYSTem:KLOCK {<Boolean>}

Query Syntax :SYSTem:KLOCK?

Parameter	<Boolean> 0	OFF
	<Boolean> 1	ON

Return parameter	0	Turn the key protection function off
	1	Turn the key protection function on.

Example :SYSTEM:KLOCK OFF
:SYSTEM:KLOCK?
->:SYSTEM:KLOCK 0

:SYSTem:BRIGhtness

Set →

→ Query

Description Sets or returns the brightness level.


Syntax :SYSTem:BRIGhtness {<Nrf>}

Query Syntax :SYSTem:BRIGhtness?

Parameter/	<Nrf>	1 to 9
------------	-------	--------

Return parameter

 Example :SYSTEM:BRIGHTNESS 7
:SYSTEM:BRIGHTNESS?
->:SYSTEM:BRIGHTNESS 7



:SYSTem:KEY:BEEPer

Description	Sets or returns the keyclick beeper state.	
Syntax	:SYSTem:KEY:BEEPer {<Boolean>}	
Query Syntax	:SYSTem:COMMunicate:LAN:CONFigure?	
Parameter	<Boolean> 0	OFF
	<Boolean> 1	ON
Return parameter	0	Turn the keyclick beeper function off.
	1	Turn the keyclick beeper function on.
Example	:SYSTEM:KEY:BEEPER OFF :SYSTEM:KEY:BEEPER? ->:SYSTEM:KEY:BEEPER 0	

STATus Command

:STATus:ERRor

→ Query

Description Queries the error code and message of the last error that has occurred (top of the error queue).

Query Syntax :STATus:ERRor?

Example :STATUS:ERROR?
 -> Error_103:Invalid separator

Note

- If no errors have occurred, 0, "No error" is returned.
 Error_103: Invalid separator
 Error_104: Data type error.
 Error_108: Parameter not allowed.
 Error_109: Missing parameter.
 Error_113: Undefined header.
 Error_131: Invalid suffix.
 Error_141: Invalid character data.
 Error_221: Setting conflict.
 Error_222: Data out of range.
 Error_813: Invalid operation.

APPENDIX

Specifications	103
General Specifications	103
Input.....	104
Display.....	104
Voltage Measurement	105
Current Measurement	105
Power Measurement.....	106
Frequency Measurement.....	106
Integrator Measurement	106
Dimensions	108
Power measurement	109
Measurement for small current	109
Measurement for large current	110
Introduction to IEC-62301	111
Recommended parameters for power measurement.....	111
EUP Directive Lot6 specifications	112
Connection Guide	113
Front panel.....	113
Lower current measurement: $I < 1A$	113
Higher current measurement: $1A < I < 10A$	113
Rear panel	114
Direct connection: $10A < I < 20A$	114
Connection with CT/PT.....	114

Specifications

Below are the basic conditions required to operate the T3PM1006 within specification:

- Calibration: Yearly
- Operating Environment: 18~28 °C (64.4~82.4°F)
- Humidity: <80%RH,
- Accuracy: \pm (% of reading + % of range)
- The specifications apply when the unit is warmed up for at least 30 minutes and operates in the slow rate.
- The power supply cable must be grounded to ensure accuracy.
- Input voltage and current must be standard sine wave.
- The power factor must be 1.
- The crest factor must be 3.
- The common-mode voltage must be zero.

General Specifications

Specification Conditions:

Temperature: 23°C \pm 5°C

Humidity: <80%RH(non-condensing)

Operating Environment: (0~40°C)

Temperature Range: 30~40°C, Relative Humidity: <70%RH(non-condensing);
>40°C, Relative Humidity: <50%RH(non-condensing)

Indoor use only

Altitude: <2000 meters

Pollution degree 2

Storage Conditions (-40~70°C)

Humidity: <90%RH(non-condensing)

General:

Power Source: 100-240 VAC 50/60Hz

Power Consumption: Max 25VA

Dimensions: 270 mm (W) X 110 mm (H) X 350 mm (D)

Weight: Approximately 2.9 kg

Input

Item	Spec.	
Input voltage	600 Vrms	
Input current	20 Arms	
Input impedance(50/60 Hz)	Voltage	2.4MΩ
	Current	5mA - 200mA
		0.5A - 20A
Maximum display voltage	700 Vrms*	
Maximum display current	25 Arms*	
Maximum allowable isolation voltage	300 V	
Low frequency filter	Cut-off frequency	500 Hz

* When measured voltage/current reaches the maximum scale (700 Vrms/25 Arms), the buzzer sounds loud for alert. In addition, It is suggested to have measurement within the safety scale (600 Vrms/20 Arms) in case of irreversible damage to the unit.

Display

Synchronization frequency	45Hz~ 6kHz
Refresh rate	10 times/sec
Average	1, 2, 4, 8, 16, 32, 64
Displayed items(Standard mode)	8 items simultaneously.
Displayed items(Simple mode)	4 items simultaneously.
Displayed digits	5
Voltage converter	1 to 9999.999
Current converter	1 to 9999.999
Measurement items	Voltage, current, active power, apparent power, reactive power, power factor, phase angle, frequency, integrated current, integrated power, positive integrated power, negative integrated power, integration time, voltage crest factor, current crest factor, voltage peak, current peak, Thd

Displayed measurement parameters	Vdc, Vrms, V+pk, V-pk, Idc, Irms, I+pk, I-pk, P, P+pk, P-pk, VA, VAR, PF, CFV, CFI, DEG, VHz, IHz, THDV, THDI
----------------------------------	---------------------------------------------------------------------------------------------------------------

Voltage Measurement

Measurement range	CF=3 : 15V, 30V, 60V, 150V, 300V, 600V CF=6 : 7.5V, 15V, 30V, 75V, 150V, 300V
Crest factor	3, 6
Effective range	1 % to 105 % of range
DC	$\pm(0.2 \% \text{ reading} + 0.2 \% \text{ range})$
Accuracy	45 Hz $\leq f \leq$ 66 Hz $\pm(0.1 \% \text{ reading} + 0.1 \% \text{ range})$ 66 Hz $< f \leq$ 1kHz $\pm(0.1 \% \text{ reading} + 0.2 \% \text{ range})$ 1 kHz $< f \leq$ 6kHz $\pm 3 \% \text{ of range}$ The filter is turned on Increase 0.3 % reading@ 45Hz to 66Hz
Temperature effect	5-18 °C / 28-40 °C Increase $\pm 0.03\% \text{ reading} / ^\circ\text{C}$
Residual noise	0.5 % of range

Current Measurement

Measurement range	5mA, 10mA, 20mA, 50mA, CF=3 : 100mA, 200mA, 500mA, 1A, 2A, 5A, 10A, 20A 2.5mA, 5mA, 10mA, 25mA, CF=6 : 50mA, 100mA, 250mA, 0.5A, 1A, 2.5A, 5A, 10A
Crest factor	3, 6
Effective range	1 % to 105 % of range
DC	$\pm(0.2 \% \text{ reading} + 0.2 \% \text{ range})$
Accuracy	45 Hz $\leq f \leq$ 66 Hz $\pm(0.1 \% \text{ reading} + 0.1 \% \text{ range})$ 66 Hz $< f \leq$ 1kHz $\pm(0.1 \% \text{ reading} + 0.2 \% \text{ range})$ 1 kHz $< f \leq$ 6kHz $\pm 3 \% \text{ of range}$

	The filter is turned on	Increase 0.3 % reading@ 45Hz to 66Hz
Temperature effect	5-18 °C / 28-40 °C	Increase $\pm 0.03\%$ reading / °C
Residual noise		0.5 % of range

Power Measurement

	Effective range	1 % to 110 % of range
	DC	$\pm(0.2 \% \text{ reading} + 0.2 \% \text{ range})$
	45 Hz $\leq f \leq$ 66 Hz	$\pm(0.1 \% \text{ reading} + 0.1 \% \text{ range})$
Accuracy	66 Hz < f \leq 1kHz	$\pm(0.1 \% \text{ reading} + 0.3 \% \text{ range})$
	1 kHz < f \leq 6kHz	$\pm 3 \% \text{ of range}$
	The filter is turned on	Increase 0.3 % reading@ 45Hz to 66Hz
Temperature effect	5-18 °C / 28-40 °C	Increase $\pm 0.03\%$ reading / °C

Frequency Measurement

Measurement range	The filter is turned on	30.000Hz to 499.99Hz
	The filter is turned off	30.000Hz to 9.9999kHz
Measurement items		Voltage, Current
Effective input range		10% to 105% of voltage input range
Accuracy		$\pm(0.06 \% \text{ reading})$

Integrator Measurement


Integrator	Accuracy	$\pm(\text{Accuracy of voltage or current} + 0.1 \% \text{ reading})$
Time	Range	0 hour 0 minute to 9999 hours 59 minutes
	Accuracy	$\pm 0.01\% \pm 1 \text{second}$

* Q (VAR), S (VA), λ (PF) and Φ (DEG) are originated from the measured values including voltage, current and active power which go through computation process. In respect to distorted signal input,



accordingly, the value acquired from other instruments, which employ different methods, may differ from that acquired from T3PM1006 unit.

* “Zero” will be shown for S or Q and “--“ will be displayed for λ and Φ when either current or voltage is less than 0.5% of the rated range (less than or equivalent to 1% when crest factor is set 6).

Dimensions

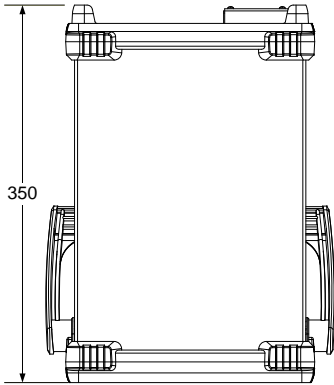

Units = mm

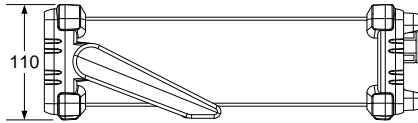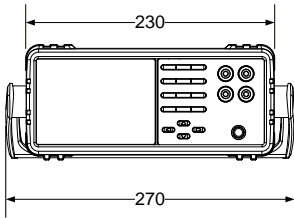


Power measurement

- Method
- Direct read method: Directly read the measurement value measured from power measuring instrument.
 - The average power method: Record the actual power value within a settable period of time and then take the average. A settable period of time isn't less than 10min. The maximum measurement interval is one second.
 - Energy accumulation method: Measure the energy within a settable period of time and then divide it by the time to get the power. A settable period of time isn't less than 10min. The cumulative energy must be greater than the resolution by 200 times.

Measurement for small current

Voltage measurement mode measured from power supply side (Connect to ammeter internally). The current measurement is accurate. The voltage measurement on load could be larger than the actual one due to partial pressure of multi-measurement ammeter.

Connection

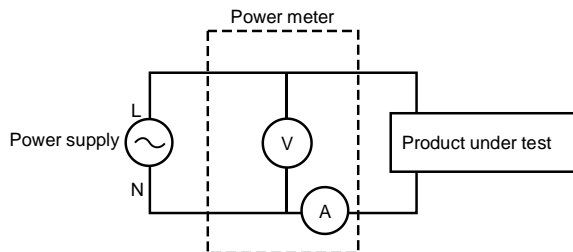


$$\text{Power loss} = (\text{Input current}[\text{A}])^2 \times 500\text{m}\Omega$$

Measurement for large current

Voltage measurement mode measured from load side (Connect to ammeter externally).

The voltage measurement is accurate. The current measurement on load could be larger than the actual one due to leakage current of multi-measurement voltage.

Connection

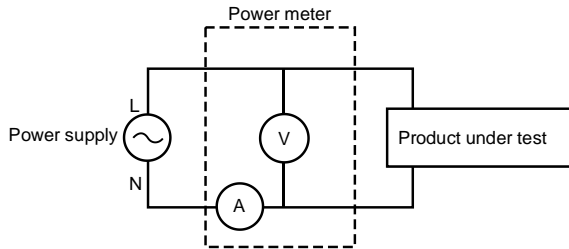

$$\text{Power loss} = (\text{Input voltage}[\text{V}])^2 / 2.4\text{M}\Omega$$

Introduction to IEC-62301

IEC 62301-2011 standard is an international basic standard for measuring standby power consumption of household appliances which is issued by IEEC. It is a standby power consumption measurement method for the various household appliances, power supply, audio and video appliances to comply with. The latest version for this standard is second edition of German standard IEC62301: 2011 (British regulations EN50564: 2011) which is issued on January, 2011. Only products that comply with the standard can have CE marking affixed on it.

Recommended parameters for power measurement

- Power resolution is less than or equal to 1mW.
- Time integrator function is available.
- Electric energy resolution is less than or equal to 1mWh and cumulative time resolution is less than or equal to 1 second.
- The crest factor is greater than or equal to 3.
- The minimum current range is less than or equal to 10mA.
- The active power includes AC and DC components.
- Over-range automatic alarm function is available.
- Turning off the auto range function is available.
- Harmonic bandwidth is greater than or equal to 2.5kHz.

The T3PM1006 meets all of the features listed above.

EUP Directive Lot6 specifications

Ecodesign directive for energy-using products:

The power loss requirement for the products with external power supply such as information devices, consumer electronics product, household appliances, toys, entertainment and sports products and so on in standby and off mode is as below.


Mode/Limit		2010.01	2013.01
Standby mode	Products with time display function.	$\leq 2W$	$\leq 1W$
	Products without time display function.	$\leq 1W$	$\leq 0.5W$
Shutdown mode		$\leq 1W$	$\leq 0.5W$

Connection Guide


Front panel

Lower current measurement: $I < 1A$

Method 1

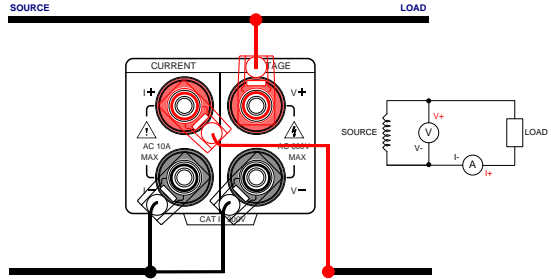


Method 2

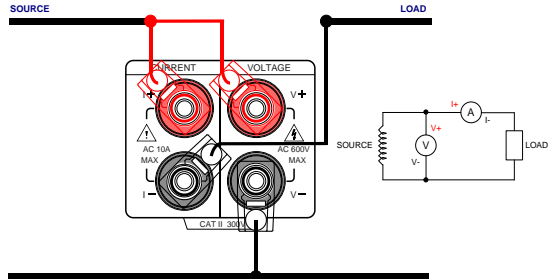


Higher current measurement: $1A < I < 10A$

Method 1

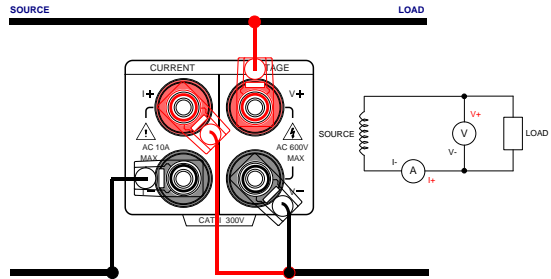


Method 2

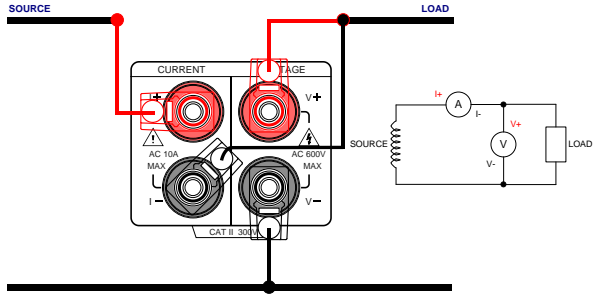


Rear panel

Direct connection: $10A < I < 20A$

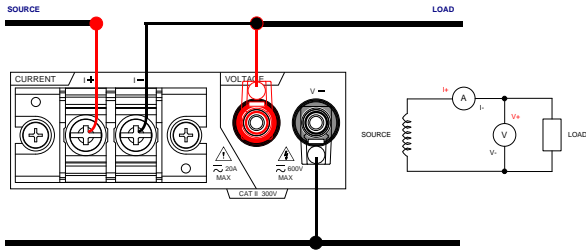

Connection with CT/PT

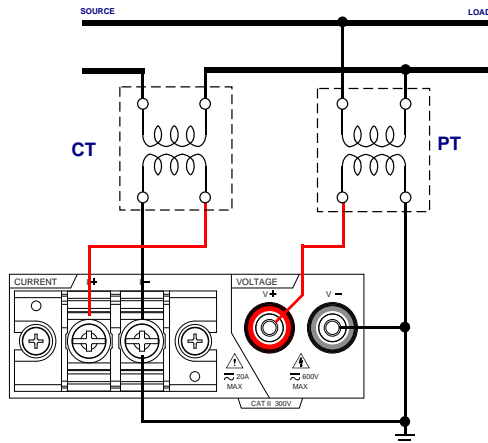

CERTIFICATIONS

Teledyne LeCroy certifies compliance to the following standards as of the time of publication. Please see the EC Declaration of Conformity document shipped with your product for current certifications.

EMC Compliance

EC DECLARATION OF CONFORMITY - EMC

The instrument meets intent of EC Directive 2014/30/EU for Electromagnetic Compatibility. Compliance was demonstrated to the following specifications listed in the Official Journal of the European Communities:

EN 61326-1:2013, EN 61326-2-1:2013 EMC requirements for electrical equipment for measurement, control, and laboratory use.¹

Electromagnetic Emissions:

EN 55011:2016+A1:2017, Radiated and Conducted Emissions Group 1, Class A ²³

EN 61000-3-2:2014 Harmonic Current Emissions, Class A

EN 61000-3-3:2013 Voltage Fluctuations and Flickers, Pst = 1

Electromagnetic Immunity:

EN 61000-4-2:2009 Electrostatic Discharge, 4 kV contact, 8 kV air, 4 kV vertical/horizontal coupling planes ⁴

EN 61000-4-3:2006+ A2:2010 RF Radiated Electromagnetic Field, 3 V/m, 80-1000 MHz; 3 V/m, 1400 MHz - 2 GHz; 1 V/m, 2 GHz - 2.7 GHz

EN 61000-4-4:2012 Electrical Fast Transient/Burst, 1 kV on power supply lines, 0.5 kV on I/O signal data and control lines ⁴

EN 61000-4-5:2014+A1:2017 Power Line Surge, 1 kV AC Mains, L-N, L-PE, N-PE⁴

EN 61000-4-6:2014 RF Conducted Electromagnetic Field, 3 Vrms, 0.15 MHz - 80 MHz

EN 61000-4-11:2004+A1:2017 Mains Dips and Interruptions, 0%/1 cycle, 70%/25 cycles, 0%/250 cycles ^{4 5}

¹ To ensure compliance with all applicable EMC standards, use high-quality shielded interface cables.

² Emissions which exceed the levels required by this standard may occur when the instrument is connected to a test object.

³ This product is intended for use in nonresidential areas only. Use in residential areas may cause electromagnetic interference.

⁴ Meets Performance Criteria “B” limits of the respective standard: during the disturbance, product undergoes a temporary degradation or loss of function or performance which is self-recoverable.

⁵ Performance Criteria “C” applied for 70%/25 cycle voltage dips and for 0%/250 cycle voltage interruption test levels per EN61000-4-11.

European Contact:*

Teledyne GmbH, European Division

Im Breitspiel 11c

D-69126 Heidelberg

Germany

Tel: + 49 6221 82700

AUSTRALIA & NEW ZEALAND DECLARATION OF CONFORMITY – EMC

The instrument complies with the EMC provision of the Radio Communications Act per the following standards, in accordance with requirements imposed by Australian Communication and Media Authority (ACMA):

AS/NZS CISPR 11:2015 Radiated and Conducted Emissions, Group 1, Class A.

Australia / New Zealand Contacts:*

RS Components Pty Ltd.

RS Components Ltd.

Suite 326 The Parade West

Units 30 & 31 Warehouse World

Kent Town, South Australia 5067 761 Great South Road

Penrose, Auckland, New Zealand

* Visit teledynelecroy.com/support/contact for the latest contact information.

Safety Compliance

EC DECLARATION OF CONFORMITY – LOW VOLTAGE

The instrument meets intent of EC Directive 2014/35/EU for Product Safety. Compliance was demonstrated to the following specifications as listed in the Official Journal of the European Communities:

EN 61010-1:2010 Safety requirements for electrical equipment for measurement, control, and laboratory use –

Part 1: General requirements

EN 61010-2:030:2010 Safety requirements for electrical equipment for measurement, control, and laboratory use –

Part 2-030: Particular requirements for testing and measuring circuits

The design of the instrument has been verified to conform to the following limits put forth by these standards:

- Mains Supply Connector: Overvoltage Category II, instrument intended to be supplied from the building wiring at utilization points (socket outlets and similar).
- Measuring Circuit Terminals: No rated measurement category. Terminals not intended to be connected directly to the mains supply.

- Unit: Pollution Degree 2, operating environment where normally only dry, non-conductive pollution occurs. Temporary conductivity caused by condensation should be expected.

Environmental Compliance

END-OF-LIFE HANDLING



The instrument is marked with this symbol to indicate that it complies with the applicable European Union requirements of Directives 2012/19/EU and 2006/66/EC on Waste Electrical and Electronic Equipment (WEEE) and Batteries.

The instrument is subject to disposal and recycling regulations that vary by country and region. Many countries prohibit the disposal of waste electronic equipment in standard waste receptacles. For more information about proper disposal and recycling of your Teledyne LeCroy product, please visit teledynelecroy.com/recycle.

RESTRICTION OF HAZARDOUS SUBSTANCES (RoHS)

EC DECLARATION OF CONFORMITY – RoHS

Unless otherwise specified, all the materials and processes are compliant with RoHS Directive 2011/65/EU in its entirety, inclusive of any further amendments or modifications of said Directive.

CHINA RoHS 2

Unless otherwise specified, all the materials and processes are compliant with the latest requirements of China RoHS 2. The hazardous substances contained in the instrument are disclosed in accordance with the standards SJ/T 11364-2014 (Marking for the restricted use of hazardous substances in electronic and electrical products) and GB/T 26572-2011 (Requirements on concentration

limits for certain restricted substances in electrical and electronic products). The instrument is marked with an appropriate Environmental Friendly Use Period (EFUP) symbol. The packaging materials include the appropriate recycling labels. The below substance disclosure tables (in Chinese and English languages) provide the required compliance information.

部件名称	有毒有害物质和元素					
	铅	汞	镉	六价铬	多溴联苯	多溴二苯醚
	(Pb)	(Hg)	(Cd)	(Cr6+)	(PBB)	(PBDE)
PCBAs	X	O	O	O	O	O
机械硬件	O	O	O	O	O	O
金属片	O	O	O	O	O	O
塑料部件	O	O	O	O	O	O
电缆组件	X	O	O	O	O	O
显示器	O	O	O	O	O	O
电源	O	O	O	O	O	O
风扇	O	O	O	O	O	O
电池	O	O	O	O	O	O
电源线	O	O	O	O	O	O
外部电源(如有)	X	O	O	O	O	O
探头(如有)	X	O	O	O	O	O
熔丝(如有)	O	O	O	O	O	O
产品外壳(如有)	O	O	O	O	O	O
适配器/模块(如有)	O	O	O	O	O	O
鼠标(如有)	O	O	O	O	O	O
O: 表明该有毒有害物质在该部件所有均质材料中的含量均在 SJ/T11364-2014 标准规定的限量要求之下。						
X: 表示该有毒有害物质至少在该部件的某一均质材料中的含量超出 SJ/T11364-2014 标准规定的限量要求。						

EFUP (对环境友好的使用时间): 30 年。

使用条件: 参阅用户手册“环境条件”部分的规定。

探头 EFUP: 10 年。

Part Name	Toxic or Hazardous Substances and Elements					
	Lead (Pb)	Mercury (Hg)	Cadmium (Cd)	Hexavalent Chromium (Cr6+)	Polybrominated Biphenyls (PBB)	Polybrominated Diphenyl Ethers (PBDE)
PCBAs	X	O	O	O	O	O
Mechanical Hardware	O	O	O	O	O	O
Sheet Metal	O	O	O	O	O	O
Plastic Parts	O	O	O	O	O	O
Cable Assemblies	X	O	O	O	O	O
Display	O	O	O	O	O	O
Power Supply	O	O	O	O	O	O
Fans	O	O	O	O	O	O
Batteries	O	O	O	O	O	O
Power Cord	O	O	O	O	O	O
Ext Power Supply (if present)	X	O	O	O	O	O
Probes (if present)	X	O	O	O	O	O
Fuse (if present)	O	O	O	O	O	O
Product Case (if present)	O	O	O	O	O	O
Adapters/Modules (if present)	O	O	O	O	O	O
Mouse (if present)	O	O	O	O	O	O

O: Indicates that this toxic or hazardous substance contained in all of the homogeneous materials for this part is below the limit requirement specified in SJ/T11364-2014.

X: Indicates that this toxic or hazardous substance contained in at least one of the homogenous materials used for this part is above the limit requirement specified in SJ/T11364-2014.

EFUP (Environmental Friendly Use Period): 30 years.

Use Conditions: Refer to the environmental conditions stated in the User Manual.

EFUP for Probes: 10 years.

ABOUT TELEDYNE TEST TOOLS



TELEDYNE TEST TOOLS
Everywhere you look™

Company Profile

Teledyne LeCroy is a leading provider of oscilloscopes, protocol analyzers and related test and measurement solutions that enable companies across a wide range of industries to design and test electronic devices of all types. Since our founding in 1964, we have focused on creating products that improve productivity by helping engineers resolve design issues faster and more effectively. Oscilloscopes are tools used by designers and engineers to measure and analyze complex electronic signals in order to develop high-performance systems and to validate electronic designs in order to improve time to market.

The Teledyne Test Tools brand extends the Teledyne LeCroy product portfolio with a comprehensive range of test equipment solutions. This new range of products delivers a broad range of quality test solutions that enable engineers to rapidly validate product and design and reduce time-to-market. Designers, engineers and educators rely on Teledyne Test Tools solutions to meet their most challenging needs for testing, education and electronics validation.

Location and Facilities

Headquartered in Chestnut Ridge, New York, Teledyne Test Tools and Teledyne LeCroy has sales, service and development subsidiaries in the US and throughout Europe and Asia. Teledyne Test Tools and Teledyne LeCroy products are employed across a wide variety of industries, including semiconductor, computer, consumer electronics, education, military/aerospace, automotive/industrial, and telecommunications.

Distributed by: